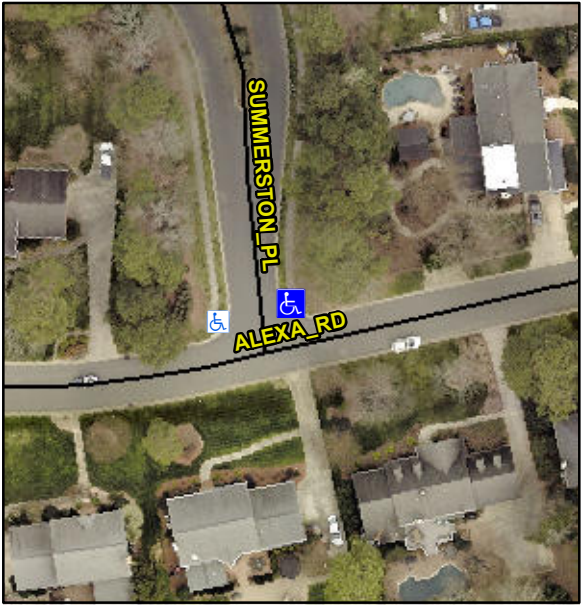


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 26876	Main Street: ALEXA_RD	Cross Street: SUMMERSTON_PL	Location: NE
ADA ID: 5360B6971709	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
	Possible Solutions:						
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.						
	Surveyor Notes:						
	N/A						
	PROW/ADA:						
	R304.5.1, R304.5.3						
		Compliance	Description	Data	Compliance	Description	Data
		N/A	Ramp Length (in)	50.0	Yes	Ramp Slope (%)	7.2
		No	Ramp Width (in)	44.0	No	Ramp XSlope (%)	5.4
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To W		X Walk 2 Direction	To S
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	2.6		X Walk 2 Slope (%)	7.6
			X Walk 1 X Slope (%)	4.8		X Walk 2 X Slope (%)	3.3
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	3.2	N/A	Clear Space?	N/A
			Road X Slope (%)	8.6	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
				N/A			N/A
					Yes	Surface Condition? (G/P)	Good
Total Cost:		\$	3200.00				

Street 1 Name SUMMERSTON PL
 Stop Condition-Street 2 StopSign
 Street 2 Name ALEXA RD
 Stop Condition-Street 1 None

