


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 7913 Main Street: BROOKSHIRE_BV Cross Street: N_CLOUDMAN_ST Location: N

ADA ID: 53AC135051FE Ramp Type: Para Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

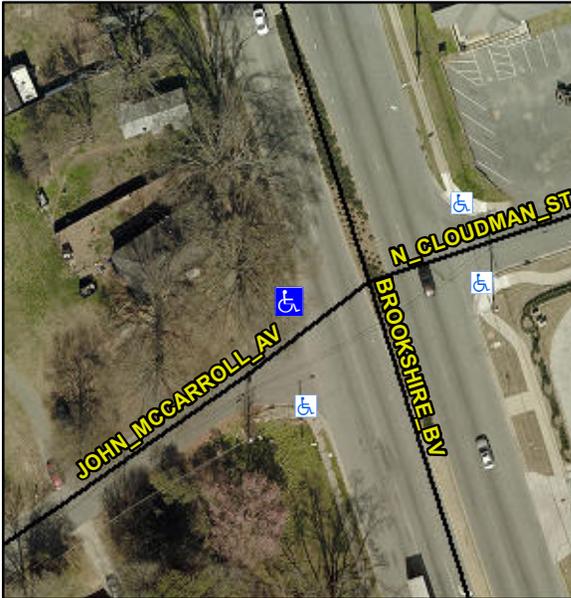

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

R304.3.2, R304.5.3

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	54.0	N/A	Ramp Length RT (in)	45.0
Yes	Ramp Width LT (in)	84.0	Yes	Ramp Width RT (in)	84.0
Yes	Ramp Slope LT (%)	1.5	No	Ramp Slope RT (%)	10.5
Yes	Ramp XSlope LT (%)	0.2	No	Ramp XSlope RT (%)	3.3
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.4		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
	Total Cost:	\$ 1600.00	N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	23.3

Street 1 Name **N CLOUDMAN ST**
 Stop Condition-Street 1 **StopSign**
 Street 2 Name **N/A**
 Stop Condition-Street 2 **N/A**

