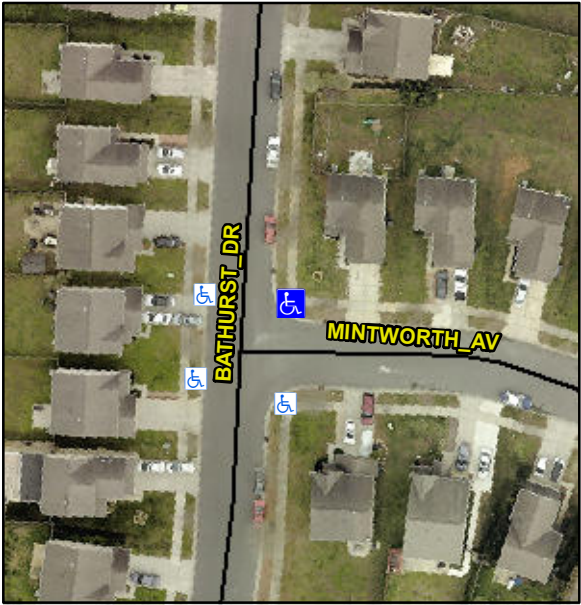


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 47610	Main Street: BATHURST_DR	Cross Street: MINTWORTH_AV	Location: NE
ADA ID: 543EE2104621	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		<b>No</b>	Ramp Length (in)	69.0
			<b>Yes</b>	Ramp Width (in)	48.0
			<b>N/A</b>	Flare Type LT	N/A
			<b>N/A</b>	Flare Slope LT (%)	N/A
			<b>N/A</b>	Flare Traversable LT?	N/A
			<b>N/A</b>	Landing Length (in)	N/A
			<b>N/A</b>	Landing Width (in)	N/A
			<b>N/A</b>	Landing Slope (%)	N/A
			<b>N/A</b>	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>R304.2.2</b></p>			<b>N/A</b>	Flare Type RT	N/A
			<b>N/A</b>	Flare Slope RT (%)	N/A
			<b>N/A</b>	Flare Traversable RT?	N/A
			<b>N/A</b>	DWS Provided?	N/A
			<b>N/A</b>	DWS Contrast?	N/A
			<b>N/A</b>	DWS Length (in)	N/A
			<b>N/A</b>	DWS Full Width?	N/A
			<b>N/A</b>	DWS Offset (in)	N/A
			<b>N/A</b>	Gutter Ponding?	N/A
			<b>N/A</b>	Gutter Lip Ht (in)	N/A
			<b>No</b>	Painted X Walk1?	N/A
			<b>To NW</b>	X Walk 1 Direction	To SW
			<b>N/A</b>	X Walk 1 Width (in)	N/A
			<b>2.3</b>	X Walk 1 Slope (%)	0.9
			<b>1.4</b>	X Walk 1 X Slope (%)	1.1
			<b>N/A</b>	Ramp inside XWalk1?	N/A
			<b>1.3</b>	Road Slope (%)	N/A
			<b>2.2</b>	Road X Slope (%)	N/A
			<b>N/A</b>	Any Obstructions?	N/A
			<b>N/A</b>	Obstruction Type	N/A
Total Cost:		\$ 3200.00	<b>N/A</b>	Clear Space?	N/A
			<b>N/A</b>	Clear Space to XWalk (in)	N/A
			<b>N/A</b>	Storm Grate/Utility Hazard?	N/A
			<b>N/A</b>	Storm Grate/Utility Type	N/A
			<b>Yes</b>	Surface Condition? (G/P)	Good

