


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 17965		Main Street: NATIONS_FORD_RD		Cross Street: SLATON_RD		Location:		NW					
ADA ID: 5462E9E929BA		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 1.25					
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance									
				Possible Solutions:		Compliance		Description		Data			
				Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		64.0		N/A	
						Yes		Ramp Width (in)		79.0		N/A	
						Yes		Ramp Slope (%)		6.4		N/A	
						No		Ramp XSlope (%)		4.3			
						N/A		Flare Type LT		N/A		N/A	
						N/A		Flare Slope LT (%)		N/A		N/A	
						N/A		Flare Traversable LT?		N/A		N/A	
						N/A		Landing Length (in)		0.0		N/A	
						N/A		Landing Width (in)		0.0		N/A	
Surveyor Notes:  N/A						N/A		Flare Type RT		N/A			
						N/A		Flare Slope RT (%)		0.0			
						N/A		Flare Traversable RT?		N/A			
						N/A		DWS Provided?		N/A			
						N/A		DWS Contrast?		N/A			
						N/A		DWS Length (in)		N/A			
						N/A		DWS Full Width?		N/A			
						N/A		DWS Offset LT (in)		N/A			
						N/A		DWS Offset RT (in)		N/A			
						N/A		Gutter Slope (%)		N/A			
PROW/ADA:  R304.5.3						N/A		Gutter X Slope (%)		N/A			
						N/A		Road Slope (%)		0.3			
						To SE		Road X Slope (%)		0.2			
						N/A		Clear Space?		N/A			
						0.3		Clear Space to XWalk (in)		N/A			
						0.2		Storm Grate/Utility Hazard?		N/A			
						N/A		Storm Grate/Utility Type					
						N/A				N/A			
								Yes		Surface Condition? (G/P)		Good	
						N/A		N/A		Curb Slope (%)		11.6	

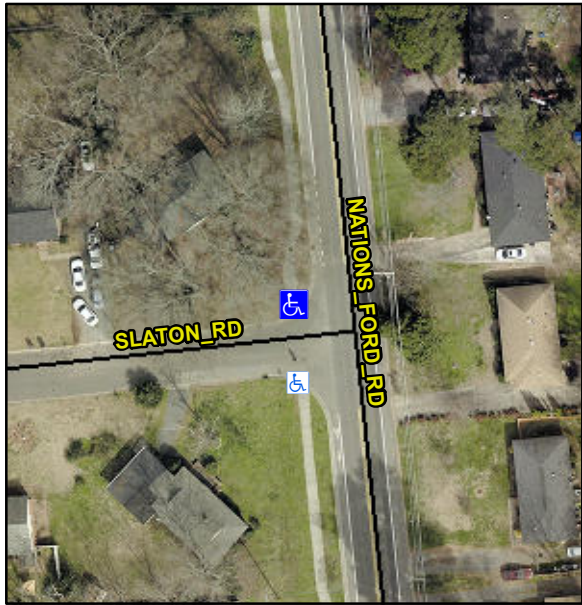