

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 52448	Main Street: WOODWARD_AV	Cross Street: DOUBLE_OAKS_RD	Location: E
ADA ID: 54894AFBDB5B	Ramp Type: MedianPerp	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

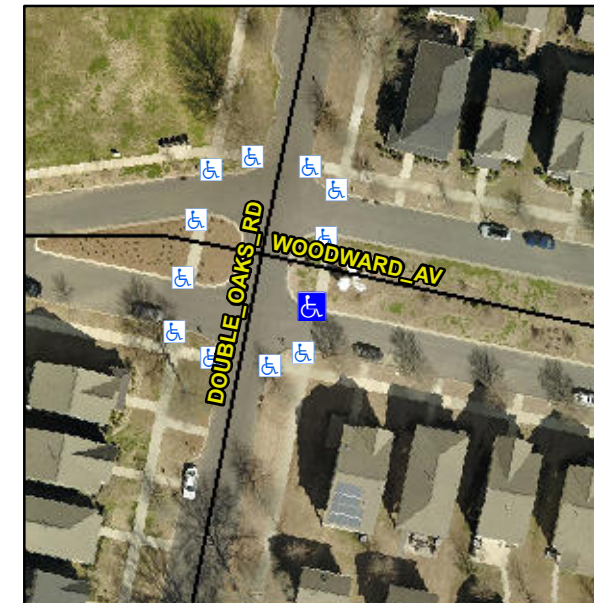

Possible Solutions:

**Remove & Replace Landing.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R304.5.4**

Total Cost: \$ 1250.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	96.0	Yes	Ramp Slope (%)	8.2
Yes	Ramp Width (in)	65.0	Yes	Ramp XSlope (%)	0.4
Yes	Flare Type L	Curbed_NoWalkSurface	Yes	Flare Type RT	N/A
Yes	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	81.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	71.5	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.5	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.1		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name **WOODWARD AV**
 Stop Condition-Street 2 **None**
 Street 2 Name **N/A**
 Stop Condition-Street 1 **N/A**

