


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 17346	Main Street: DEVON_DR	Cross Street: WILLOW_OAK_RD	Location:	N
ADA ID: 54E8F5A420AA	Ramp Type: Directional2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

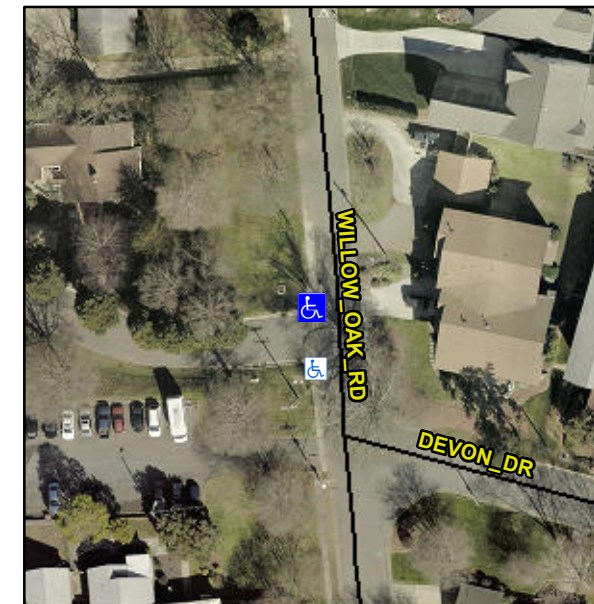

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.1, R304.5.3

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	116.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	48.0	No	Grade Break Slope (%)	7.0
Yes	Ramp Slope (%)	7.7	Yes	Grade Break XSlope (%)	0.5
Yes	Ramp XSlope (%)	0.9			
Yes	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	1.9
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	46.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	53.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.7	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	4.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	28.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	0.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.4
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.3
N/A	Painted X Walk1?	No		Road Slope (%)	4.8
	X Walk 1 Direction	To SE		Road X Slope (%)	4.1
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	4.8	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	4.1	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	8.3

Total Cost: \$ 1800.00

Street 1 Name	DEVON RD
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

