

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 43015	Main Street: BRISTOL_PLACE_CT	Cross Street: SPRINGS_FARM_LN	Location: NE
ADA ID: 555186A33E2B	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 17.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

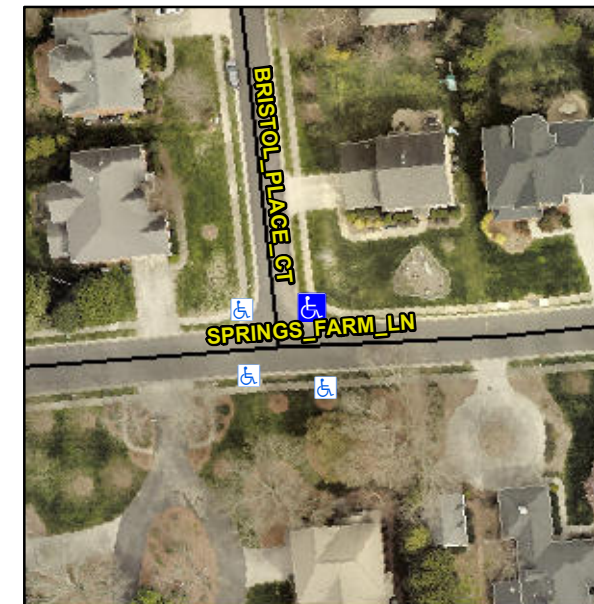

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para, R305, R302.7.2

Total Cost: \$ 3400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	49.0	Yes	Ramp Slope (%)	5.3
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.1
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	8.2	Yes	Flare Slope RT (%)	8.3
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	49.0	No	DWS Provided?	No
Yes	Landing Width (in)	48.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	2.9	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	1.8	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.6
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.0		X Walk 2 Slope (%)	4.4
	X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	1.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.0	N/A	Clear Space?	Yes
	Road X Slope (%)	0.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name **BRISTOL PLACE CT**

Stop Condition-Street 2 **StopSign**

Street 2 Name **SPRINGS FARM LN**

Stop Condition-Street 1 **None**

