


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 18977	Main Street: COLONY_RD	Cross Street: WHEELock_RD	Location: NE
ADA ID: 55880380E32B	Ramp Type: ParaDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

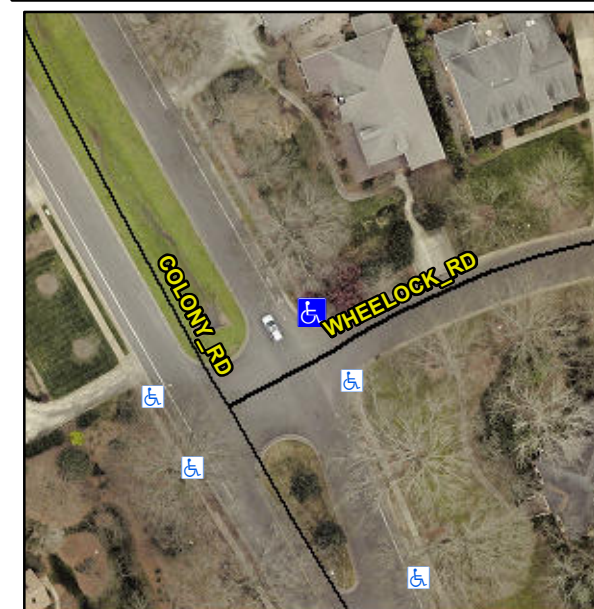

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

ASP LIP 0.5

PROW/ADA:

Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	47.0	N/A	Ramp Length RT (in)	50.5
Yes	Ramp Width LT (in)	50.0	Yes	Ramp Width RT (in)	70.0
Yes	Ramp Slope LT (%)	5.5	Yes	Ramp Slope RT (%)	7.2
Yes	Ramp XSlope LT (%)	1.3	Yes	Ramp XSlope RT (%)	0.9
Yes	Landing Length (in)	71.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	44.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.3	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	0.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.9
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.7		X Walk 2 Slope (%)	3.8
	X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	2.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.3	N/A	Clear Space?	Yes
	Road X Slope (%)	6.7	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Replace	Curb Slope (%)	10.7

