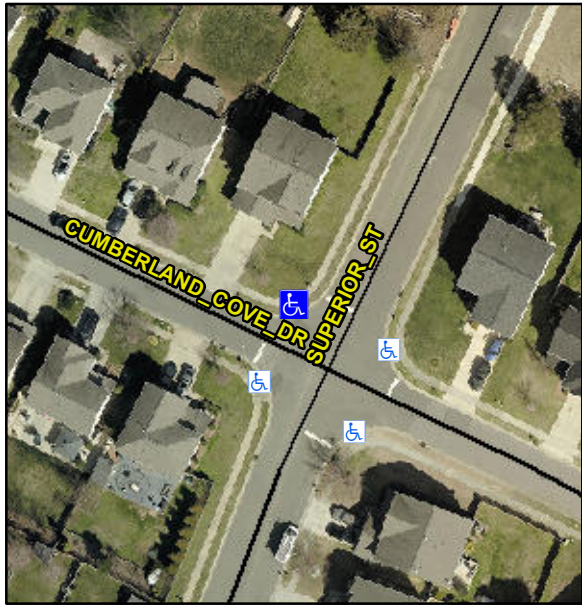


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 46758	Main Street: CUMBERLAND_COVE_DR	Cross Street: SUPERIOR_ST	Location: NW
ADA ID: 55B8F0352ED8	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:		Compliance		Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	47.0	No	Ramp Slope (%)	10.3	
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.4	
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
			N/A	Shared Landing?	N/A				
PROW/ADA:			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
				X Walk 1 Direction	To SW		X Walk 2 Direction	To SE	
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
				X Walk 1 Slope (%)	4.0		X Walk 2 Slope (%)	0.9	
				X Walk 1 X Slope (%)	2.4		X Walk 2 X Slope (%)	3.9	
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
				Road Slope (%)	2.9	N/A	Clear Space?	N/A	
				Road X Slope (%)	4.5	N/A	Clear Space to XWalk (in)	N/A	
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
				Obstruction Type			Storm Grate/Utility Type		
					N/A			N/A	
						Yes	Surface Condition? (G/P)	Good	

Street 1 Name	CUMBERLAND COVE DR
Stop Condition-Street 2	StopSign
Street 2 Name	SUPERIOR ST
Stop Condition-Street 1	StopSign

Total Cost:	\$	3200.00
-------------	----	---------

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	47.0	No	Ramp Slope (%)	10.3
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.4
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.0		X Walk 2 Slope (%)	0.9
	X Walk 1 X Slope (%)	2.4		X Walk 2 X Slope (%)	3.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.9	N/A	Clear Space?	N/A
	Road X Slope (%)	4.5	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

