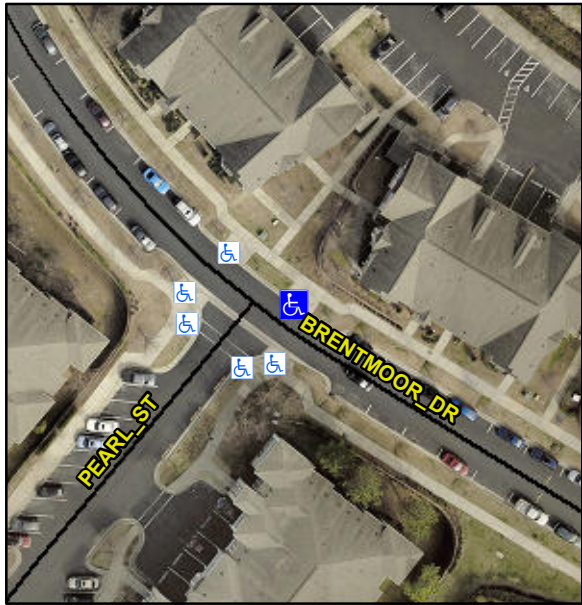


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 51356	Main Street: BRENTMOOR_DR	Cross Street: PEARL_ST	Location:	E
ADA ID: 55E936ABFD84	Ramp Type: Combination2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance													
	Possible Solutions:		Compliance			Description			Data	Compliance			Description			Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)			N/A	Ramp Length RT (in)			72.0					
	Remove & Replace Gutter.		N/A	Ramp Width LT (in)			N/A	Ramp Width RT (in)			60.0					
			N/A	Ramp Slope LT (%)			N/A	Ramp Slope RT (%)			7.3					
			N/A	Ramp XSlope LT (%)			N/A	Ramp XSlope RT (%)			4.8					
			N/A	Ramp Length (in)			85.0	Ramp Slope (%)			5.1					
			Yes	Ramp Width (in)			59.0	Ramp XSlope (%)			3.6					
			N/A	Flare Type LT			Sloped	Flare Type RT			Sloped					
			Yes	Flare Slope LT (%)			2.7	Flare Slope RT (%)			6.9					
			N/A	Flare Traversable LT?			Yes	Flare Traversable RT?			Yes					
Surveyor Notes: N/A			Yes	Landing Length (in)			72.0	DWS Provided?			Yes					
			Yes	Landing Width (in)			60.0	DWS Contrast?			Yes					
			No	Landing Slope (%)			3.0	DWS Length (in)			24.5					
			Yes	Landing X Slope (%)			1.1	DWS Full Width?			Yes					
			N/A	Landing Curb? (Y/N)			No	DWS Offset (in)			1.0					
			N/A	Shared Landing?			No									
			Yes	Gutter Ponding?			No	Gutter Slope (%)			2.3					
			Yes	Gutter Lip Ht (in)			0.0	Gutter X Slope (%)			4.1					
			N/A	Painted X Walk1?			No	Painted X Walk2?			N/A					
				X Walk 1 Direction			To SW	X Walk 2 Direction			N/A					
PROW/ADA: Not Found, R304.5.3, R304.2.2-Perp, R304.3.2-Para				X Walk 1 Width (in)			N/A	X Walk 2 Width (in)			N/A					
				X Walk 1 Slope (%)			3.1	X Walk 2 Slope (%)			N/A					
				X Walk 1 X Slope (%)			1.2	X Walk 2 X Slope (%)			N/A					
			N/A	Ramp inside XWalk1?			N/A	Ramp inside XWalk2?			N/A					
				Road Slope (%)			N/A	Clear Space?			Yes					
				Road X Slope (%)			N/A	Clear Space to XWalk (in)			N/A					
								Yes			Any Obstruction?	No				
											Obstruction Type	N/A				
			Yes	Storm Grate/Utility Hazard?			No	Storm Grate/Utility Type			N/A					
			Yes	Surface Condition? (G/P)			Good	Curb Slope (%)			24.6					
Street 1 Name			None													
Stop Condition-Street 1			BRENTMOOR DR													
Street 2 Name			N/A													
Stop Condition-Street 2			N/A													
Total Cost:			\$ 2350.00													
