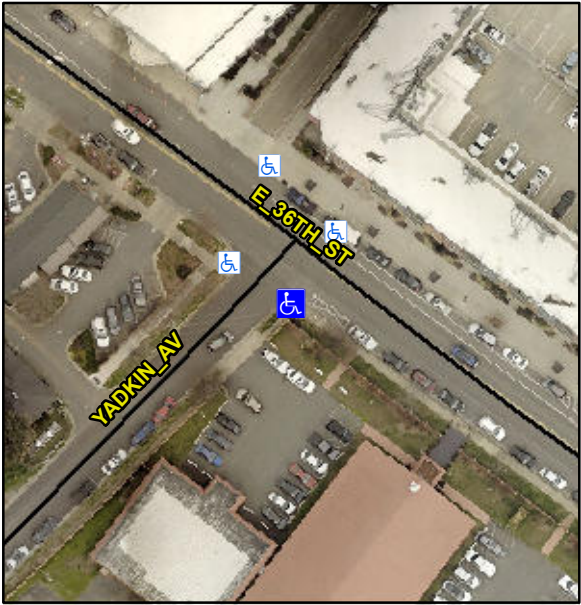


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10071	Main Street: E_36TH_ST	Cross Street: YADKIN_AV	Location: S
ADA ID: 56389B0514FA	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 33.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		<b>No</b>	Ramp Length (in)	<b>57.5</b>
			<b>No</b>	Ramp Width (in)	<b>47.5</b>
			<b>N/A</b>	Flare Type LT	<b>N/A</b>
			<b>N/A</b>	Flare Slope LT (%)	<b>N/A</b>
			<b>N/A</b>	Flare Traversable LT?	<b>N/A</b>
			<b>N/A</b>	Landing Length (in)	<b>N/A</b>
			<b>N/A</b>	Landing Width (in)	<b>N/A</b>
			<b>N/A</b>	Landing Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing X Slope (%)	<b>N/A</b>
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.5.1, R304.2.2, R304.5.3</b></p>			<b>N/A</b>	Flare Type RT	<b>N/A</b>
			<b>N/A</b>	Flare Slope RT (%)	<b>N/A</b>
			<b>N/A</b>	Flare Traversable RT?	<b>N/A</b>
			<b>N/A</b>	DWS Provided?	<b>N/A</b>
			<b>N/A</b>	DWS Contrast?	<b>N/A</b>
			<b>N/A</b>	DWS Length (in)	<b>N/A</b>
			<b>N/A</b>	DWS Full Width?	<b>N/A</b>
			<b>N/A</b>	DWS Offset (in)	<b>N/A</b>
			<b>N/A</b>	Gutter Slope (%)	<b>N/A</b>
			<b>N/A</b>	Gutter X Slope (%)	<b>N/A</b>
			<b>No</b>	Painted X Walk1?	<b>Yes</b>
				X Walk 1 Direction	<b>To NE</b>
			<b>N/A</b>	X Walk 1 Width (in)	<b>N/A</b>
			<b>4.2</b>	X Walk 1 Slope (%)	<b>2.5</b>
			<b>0.4</b>	X Walk 1 X Slope (%)	<b>0.1</b>
			<b>N/A</b>	Ramp inside XWalk1?	<b>Yes</b>
			<b>1.1</b>	Road Slope (%)	<b>N/A</b>
			<b>3.2</b>	Road X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Any Obstructions?	<b>N/A</b>
				Obstruction Type	
Total Cost: \$ 3200.00			<b>N/A</b>	Storm Grate/Utility Hazard?	<b>N/A</b>
			<b>N/A</b>	Storm Grate/Utility Type	
			<b>Yes</b>	Surface Condition? (G/P)	<b>Good</b>

