


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12413	Main Street: N_BREVARD_ST	Cross Street: E_6TH_ST	Location: E
ADA ID: 563C7AA8A0D5	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

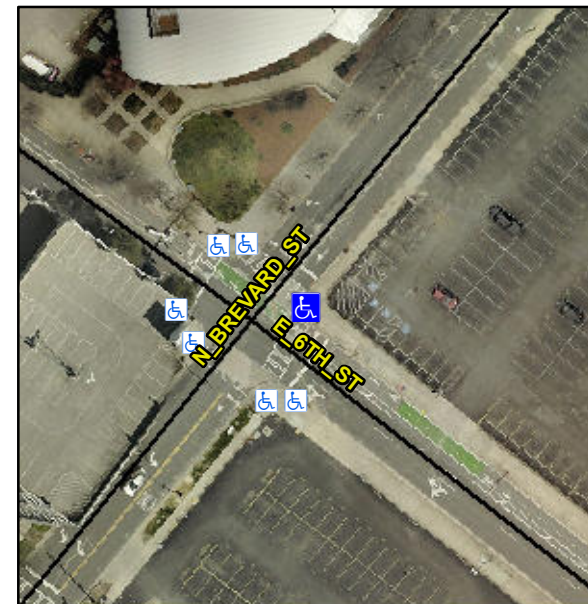

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305.2

Street 1 Name **N BREVARD ST**
 Stop Condition-Street 2 **Signal**
 Street 2 Name **E 6TH ST**
 Stop Condition-Street 1 **Signal**

Total Cost: \$ **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	64.0	Yes	Ramp Slope (%)	7.5
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	3.3
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	8.3	Yes	Flare Slope RT (%)	7.1
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.7	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	3.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	Yes	No	DWS Offset (in)	15.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.7
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	104.0	N/A	X Walk 2 Width (in)	108.0
	X Walk 1 Slope (%)	2.9		X Walk 2 Slope (%)	0.6
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	1.6
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	3.3	N/A	Clear Space?	Yes
	Road X Slope (%)	1.1	Yes	Clear Space to XWalk (in)	48.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		Yes	Yes	Surface Condition? (G/P)	Good

