


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 17196Main Street:IDLEWILD_RDCross Street:CONFERENCE_DRLocation:SWADA ID: 56490532FBD4Ramp Type:PerpInitial Pass/Fail:FailOverall Compliance:NoSeverity Score:22.5

Codes/Mitigation Info/Possible Solution

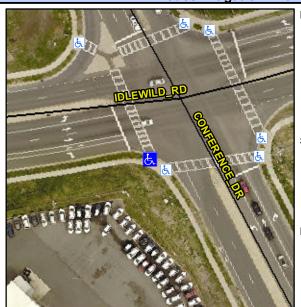

Street 1 Name

Stop Condition-Street 2

Signal
Street 2 Name

N/A

Stop Condition-Street 1

N/A

1 CCCIBIC CCIALICIT	
Possible Solutions:	9
Remove & Replace Entire Ramp.	N
	N
	N
	N
	N
	N
Surveyor Notes:	N
N/A	N
	N
	N
	N
PROW/ADA:	N
R304.5.1, R304.2.2, R304.5.3	N
	N
	N
	N
	ľ





Total Cost:



1850.00

Field Measurements/Component Compliance								
Compl	iance Description	Data	Comp	liance	Description	Data		
N/A	Ramp Length (in)	67.0	No	Ramp	Slope (%)	9.4		
No	Ramp Width (in)	47.0	No	Ramp	XSlope (%)	4.8		
N/A	Flare Type LT	N/A	N/A	Flare	Type RT	N/A		
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A		
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A		
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A		
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A		
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A		
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A		
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A		
N/A	Shared Landing?	N/A						
N/A	Gutter Ponding?	N/A	N/A	Gutte	r Slope (%)	N/A		
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	r X Slope (%)	N/A		
N/A	Painted X Walk1?	Yes	N/A	Paint	ed X Walk2?	N/A		
	X Walk 1 Direction	To NW		X Wa	lk 2 Direction	N/A		
N/A	X Walk 1 Width (in)	104.0	N/A	X Wa	lk 2 Width (in)	N/A		
	X Walk 1 Slope (%)	3.8		X Wa	lk 2 Slope (%)	N/A		
	X Walk 1 X Slope (%)	1.9		X Wa	lk 2 X Slope (%)	N/A		
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp	inside XWalk2?	N/A		
	Road Slope (%)	N/A	N/A	Clear	Space?	N/A		
	Road X Slope (%)	N/A	N/A	Clear	Space to XWalk (in)	N/A		
N/A	Any Obstructions?	N/A	N/A	Storm	n Grate/Utility Hazard?	N/A		
	Obstruction Type			Storm	n Grate/Utility Type			
		N/A				N/A		
			Yes	Surfa	ce Condition? (G/P)	Good		