

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Data

66.0

39.0

9.8

3.6

6.1

7.1

N/A

Intersection ID: 8369 Main Street: LASALLE ST **Cross Street: SENIOR DR** Location: NW Initial Pass/Fail: Fail **Overall Compliance: No** ADA ID: 564C37E7A86D Ramp Type: Combination1 Severity Score: 46.25

**Codes/Mitigation Info/Possible Solution** 

## Field Measurements/Component Compliance

N/A

No

No

No

Yes

No

N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

**DWS Contrast?** 

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

Flare Traversable RT?

Ramp XSlope RT (%)

Data

61.0

39.0

4.5

5.1

64.0

39.0

N/A

No

To E

Ramp Length LT (in)

Ramp Width LT (in)

Ramp Slope LT (%)

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)

Shared Landing?

**Gutter Ponding?** 

Gutter Lip Ht (in)


Painted X Walk1?

X Walk 1 Direction

Flare Traversable LT?

Flare Type LT

Ramp XSlope LT (%)

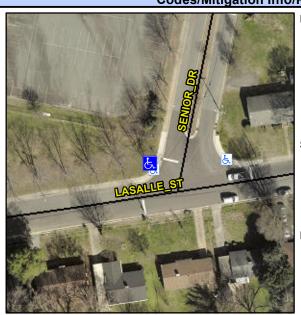

Street 1 Name StopSign Stop Condition-Street 1 SENIOR DR Street 2 Name N/A Stop Condition-Street 2 N/A Possible Solutions: Compliance Description N/A Remove & Replace Entire Ramp. No Yes No N/A No Surveyor Notes: N/A LT RP < 5% N/A N/A N/A N/A PROW/ADA: N/A Not Found, R304.5.1, R304.5.1, N/A R304.5.3, R304.3.2 N/A N/A N/A N/A N/A

Total Cost:



				_			
			X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	4.6		X Walk 2 Slope (%)	N/A
			X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	N/A
1800	0.00	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	N/A		Clear Space?	N/A
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
					N/A	Any Obstruction?	N/A
						Obstruction Type	
							N/A
					N/A	Storm Grate/Utility Hazard?	N/A
						Storm Grate/Utility Type	N/A
		Zak					N/A
					Yes	Surface Condition? (G/P)	Good
						Curb Slope (%)	20.3
	Y			'	•	,	

