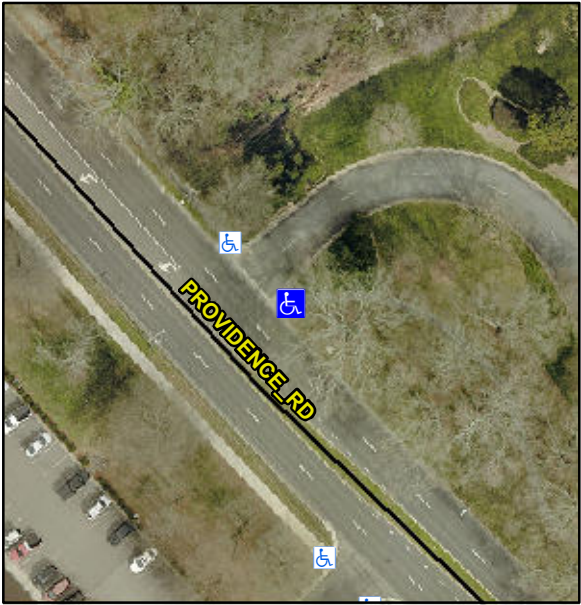


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10035065	Main Street: PROVIDENCE_RD	Cross Street: N/A	Location: SE
ADA ID: 565ADA2E5343	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>	
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		N/A	Ramp Length (in)	51.0	No
			Yes	Ramp Width (in)	64.0	No
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	N/A	N/A
			N/A	Landing Width (in)	N/A	N/A
			N/A	Landing Slope (%)	N/A	N/A
			N/A	Landing X Slope (%)	N/A	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	
			N/A	Gutter Ponding?	N/A	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To N	To W
			N/A	X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	0.6	X Walk 2 Slope (%)
				X Walk 1 X Slope (%)	4.3	X Walk 2 X Slope (%)
			N/A	Ramp inside XWalk1?	N/A	N/A
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.2.2, R304.5.3</b></p>			N/A	Road Slope (%)	5.1	N/A
				Road X Slope (%)	2.1	N/A
			N/A	Any Obstructions?	N/A	N/A
				Obstruction Type		
					N/A	N/A
			Yes	Surface Condition? (G/P)		Good

Street 1 Name	ENTRANCE
Stop Condition-Street 2	StopSign
Street 2 Name	PROVIDENCE RD
Stop Condition-Street 1	None

Total Cost: \$ 3200.00

