


# Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 25627      Main Street: KATHRYN BLAIR LN      Cross Street: STALLWORTH DR      Location: NE

ADA ID: 565D6C13A7BA      Ramp Type: PerpDiag      Initial Pass/Fail: Fail      Overall Compliance: No      Severity Score: 8.75

**Codes/Mitigation Info/Possible Solution**      **Field Measurements/Component Compliance**

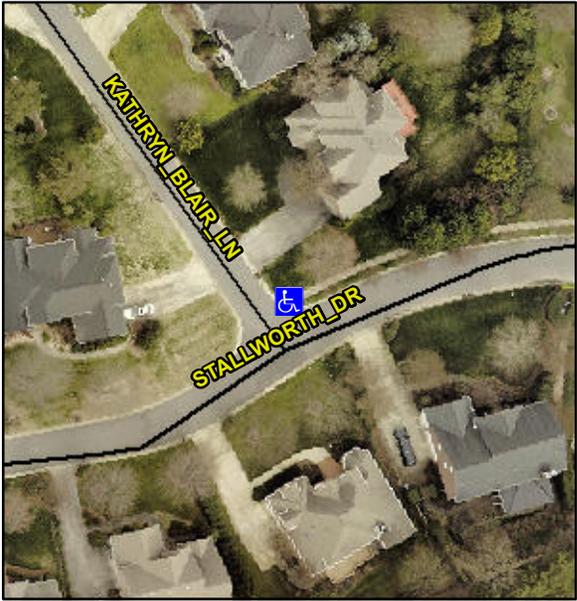

Possible Solutions:  
**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:  
**N/A**

PROW/ADA:  
**R304.5.1**

Street 1 Name                    **KATHRYN BLAIR LN**  
Stop Condition-Street 2            **StopSign**  
Street 2 Name                    **STALLWORTH DR**  
Stop Condition-Street 1            **None**

Total Cost:                                    \$    **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	66.0	Yes	Ramp Slope (%)	5.3
No	Ramp Width (in)	47.0	Yes	Ramp XSlope (%)	1.3
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	7.8		X Walk 2 Slope (%)	3.5
	X Walk 1 X Slope (%)	2.3		X Walk 2 X Slope (%)	6.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.0	N/A	Clear Space?	N/A
	Road X Slope (%)	7.2	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

