


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 10014956	Main Street: MOODY_RD	Cross Street: N/A	Location: SW
ADA ID: 56725E7BEDDF	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 10

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

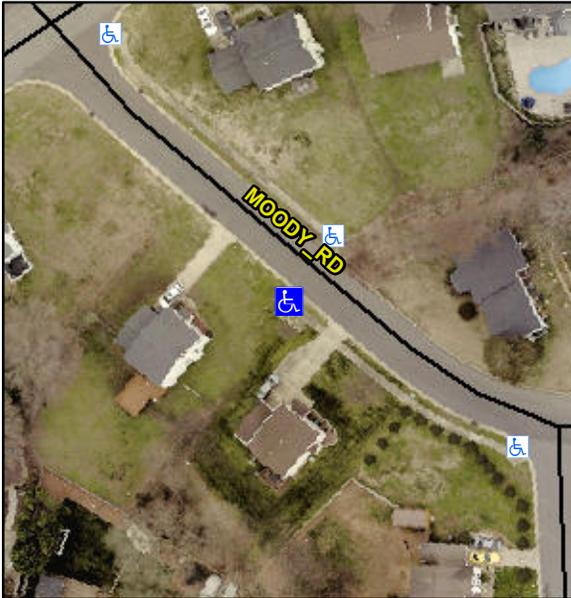

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R305, R302.7

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	47.5	Yes	Ramp Slope (%)	5.7
Yes	Ramp Width (in)	49.0	Yes	Ramp XSlope (%)	0.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	2.6	N/A	Flare Slope RT (%)	6.0
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	No	DWS Provided?	No
Yes	Landing Width (in)	79.5	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	0.1	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	3.8	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	5.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.8
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.6		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 1850.00

Street 1 Name	MOODY RD
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

