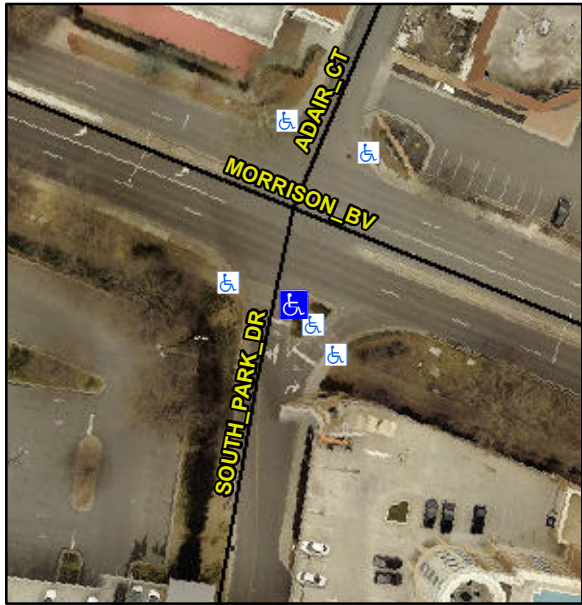


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 19935	Main Street: MORRISON_BV	Cross Street: ADAIR_CT	Location: SW
ADA ID: 567413E33F5A	Ramp Type: MedianPerp	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	53.0	No	Ramp Slope (%)	14.5
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.9
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
PROW/ADA:		R304.2.2, R304.5.3	N/A	Shared Landing?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Ponding?	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Painted X Walk2?	N/A
			N/A	Painted X Walk1?	Yes	N/A	X Walk 2 Direction	N/A
				X Walk 1 Direction	To NW		X Walk 2 Width (in)	N/A
			N/A	X Walk 1 Width (in)	96.0	N/A	X Walk 2 Slope (%)	N/A
				X Walk 1 Slope (%)	0.6		X Walk 2 X Slope (%)	N/A
				X Walk 1 X Slope (%)	0.9		Ramp inside XWalk2?	N/A
			N/A	Ramp inside XWalk1?	Yes	N/A	Clear Space?	N/A
				Road Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
				Road X Slope (%)	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Type	N/A
				Obstruction Type				
						N/A		N/A
						Yes	Surface Condition? (G/P)	Good
Total Cost:		\$ 1650.00						

Street 1 Name	ADAIR CT
Stop Condition-Street 2	StopSign
Street 2 Name	N/A
Stop Condition-Street 1	N/A

