


Intersection ID: 10023016	Main Street: CENTER_PARK_DR	Cross Street: N/A	Location:	SW
ADA ID: 56AFB8E0226F	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	76.0	No	Ramp Slope (%)	9.4
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	6.7
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
	Surveyor Notes:		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
PROW/ADA:		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
				N/A	Shared Landing?	N/A		
		Not Found, R304.2.2, R304.5.3		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To E		X Walk 2 Direction	To N	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	3.1		X Walk 2 Slope (%)	0.2	
			X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	6.0	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	1.4	N/A	Clear Space?	N/A	
			Road X Slope (%)	0.6	N/A	Clear Space to XWalk (in)	N/A	
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
			Obstruction Type			Storm Grate/Utility Type		
				N/A				N/A
					Yes	Surface Condition? (G/P)	Good	

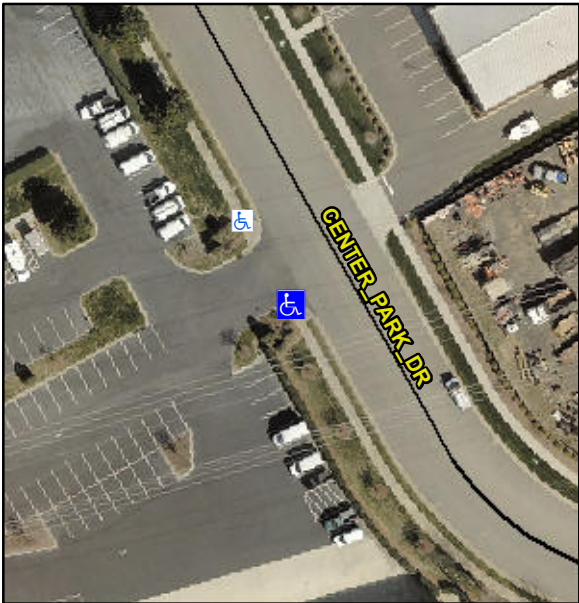