


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10020701	Main Street: BEATTIES_FORD_RD	Cross Street: N/A	Location: W
ADA ID: 56B7BA7B812D	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 40

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

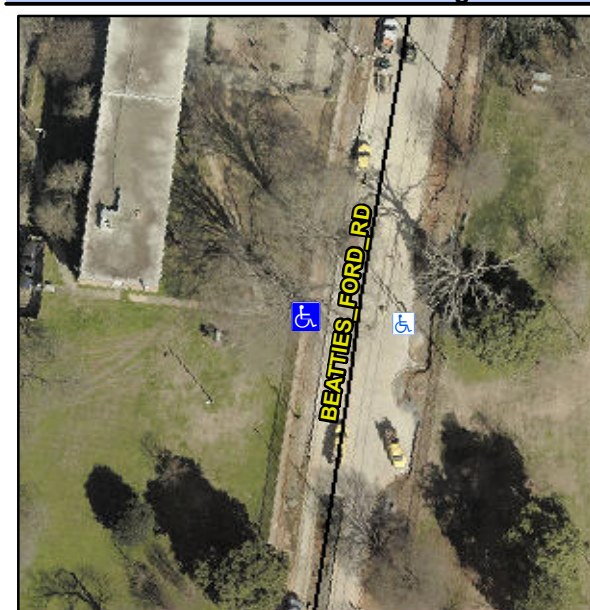

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.1, R304.2.2-Perp, R304.3.2-
Para, R304.5.3, R305, R302.7.2,
R304.5.4**

Street 1 Name	BEATTIES FORD RD
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost: \$ 2600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	76.0	Yes	Ramp Slope (%)	5.8
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.8
N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
No	Landing Length (in)	N/A	No	DWS Provided?	No
No	Landing Width (in)	N/A	N/A	DWS Contrast?	No
No	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.4
No	Gutter Lip Ht (in)	1.5	Yes	Gutter X Slope (%)	1.3
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.7		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

