

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12869	Main Street: E_TRADE_ST	Cross Street: N_ALEXANDER_ST	Location: N
ADA ID: 56CF29F27DDA	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

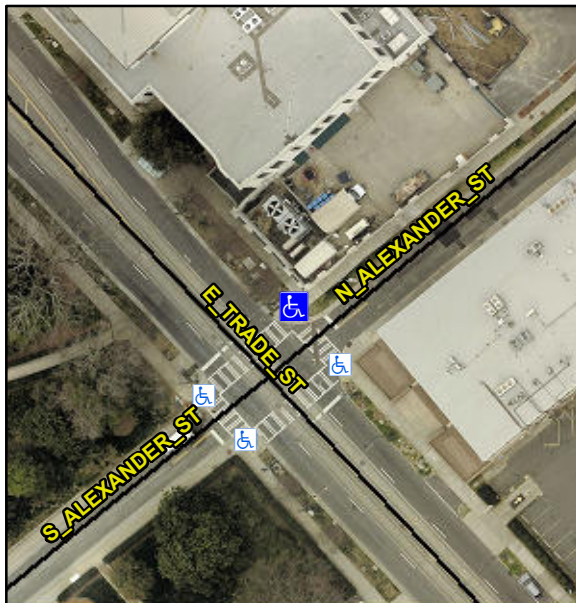

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.3.2, R304.5.3

Street 1 Name **E TRADE ST**
 Stop Condition-Street 1 **Signal**
 Street 2 Name **N ALEXANDER ST**
 Stop Condition-Street 2 **Signal**

Total Cost: \$ **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	57.0	N/A	Ramp Length RT (in)	53.0
Yes	Ramp Width LT (in)	60.0	Yes	Ramp Width RT (in)	61.0
Yes	Ramp Slope LT (%)	5.6	No	Ramp Slope RT (%)	10.3
Yes	Ramp XSlope LT (%)	1.1	No	Ramp XSlope RT (%)	2.5
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	111.0	N/A	X Walk 2 Width (in)	112.0
	X Walk 1 Slope (%)	7.4		X Walk 2 Slope (%)	6.8
	X Walk 1 X Slope (%)	4.8		X Walk 2 X Slope (%)	8.9
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.3	N/A	Clear Space?	N/A
	Road X Slope (%)	0.2	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	7.6

