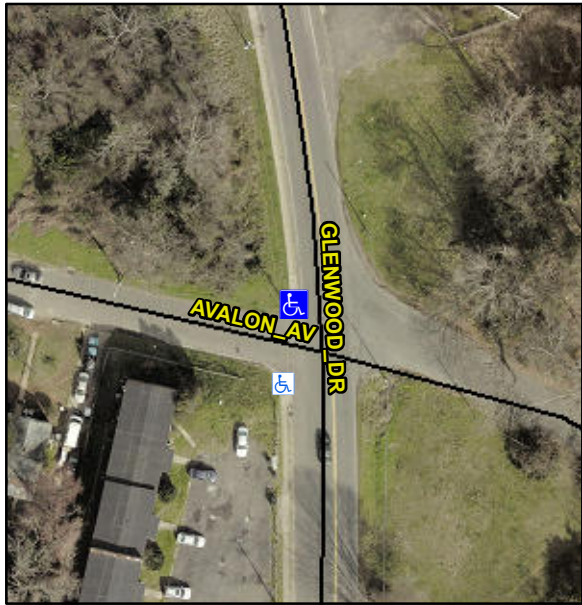


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 9949	Main Street: AVALON_AV	Cross Street: GLENWOOD_DR	Location: NW
ADA ID: 57CA644B1A20	Ramp Type: BlendTrans1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 8.75	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance								
 <div>Street 1 Name AVALON AV</div> <div>Stop Condition-Street 1 StopSign</div> <div>Street 2 Name N/A</div> <div>Stop Condition-Street 2 N/A</div>	Possible Solutions:		Compliance			Compliance					
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Description			Data					
	Surveyor Notes: NO LT SW		N/A			Ramp Length (in)			48.0		
			No			Ramp Width (in)			47.5		
			N/A			Flare Type LT			N/A		
			N/A			Flare Slope LT (%)			N/A		
			N/A			Flare Traversable LT?			N/A		
			N/A			Landing Length (in)			N/A		
			N/A			Landing Width (in)			N/A		
			N/A			Landing Slope (%)			N/A		
			N/A			Landing X Slope (%)			N/A		
			N/A			Landing Curb? (Y/N)			N/A		
	PROW/ADA: R304.5.1		N/A			Shared Landing?			N/A		
			N/A			Gutter Ponding?			N/A		
			N/A			Gutter Lip Ht (in)			N/A		
			N/A			Painted X Walk1?			No		
						X Walk 1 Direction			To S		
						X Walk 1 Width (in)			N/A		
						X Walk 1 Slope (%)			4.4		
						X Walk 1 X Slope (%)			5.3		
N/A			Ramp inside XWalk1?			N/A					
			Road Slope (%)			5.3					
		N/A			Road X Slope (%)			4.4			
		N/A			Any Obstructions?			N/A			
					Obstruction Type						
								N/A			
								Yes			
								N/A			
								Surface Condition? (G/P)			
								Good			
								Curb Slope (%)			
								3.0			

