


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 53763	Main Street: NORTH_COMMUNITY_HOUSE_RD	Cross Street: COMMUNITY_COMMONS_RD	Location: NE
ADA ID: 58A63D3FB54F	Ramp Type: Directional	Initial Pass/Fail: Pass	Overall Compliance: Yes
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

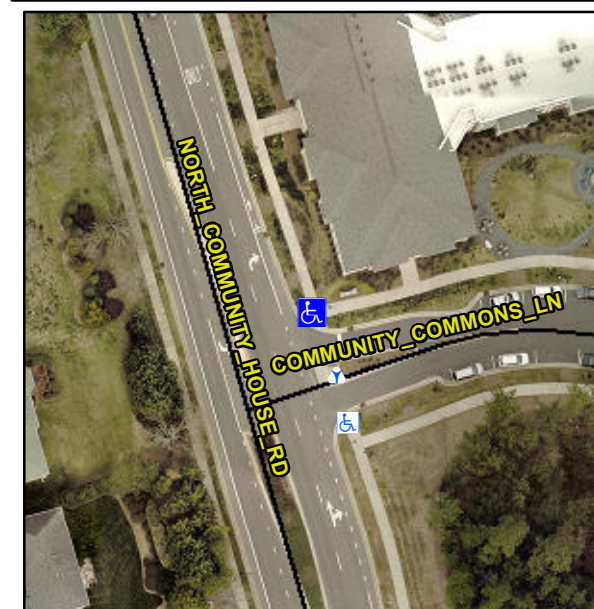

Possible Solutions:

N/A

Surveyor Notes:

N/A

PROW/ADA:

N/A

Street 1 Name **COMMUNITY COMMONS LN**

Stop Condition-Street 1 **StopSign**

Street 2 Name **N/A**

Stop Condition-Street 2 **N/A**

Total Cost: \$ 0.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	96.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	70.0	Yes	Grade Break Slope (%)	1.9
Yes	Ramp Slope (%)	2.9	Yes	Grade Break XSlope (%)	1.9
Yes	Ramp XSlope (%)	1.4			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	71.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	71.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	0.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	48.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.3
N/A	Painted X Walk1?	No		Road Slope (%)	2.3
	X Walk 1 Direction	To SE		Road X Slope (%)	0.7
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.3	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.7	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	6.1

