

## Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 10020275 Main Street: AYRSLEY\_TOWN\_BV Cross Street: N/A Location: N

ADA ID: 5970B46CADE0 Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 12.5

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

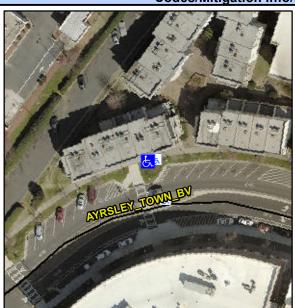

Street 1 Name
AYRSLEY TOWN BV
Stop Condition-Street 2
None
Street 2 Name
N/A
Stop Condition-Street 1
N/A

Possible Solutions:

Remove & Replace Entire Ramp.

N/A

N/A

Surveyor Notes:

N/A

N/A

N/A

N/A

PROW/ADA:

NOT Found, R304.5.3

N/A

N/A

Total Cost: \$ 1850.00

Field Measurements/Component Compliance						
Compliance Description		Data	Compliance		Description	Data
N/A	Ramp Length (in)	116.0	Yes	Ram	Slope (%)	7.7
Yes	Ramp Width (in)	80.0	No	Ram	XSlope (%)	6.7
N/A	Flare Type LT	N/A	N/A	Flare Type RT		N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutte	r Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	r X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Paint	ed X Walk2?	N/A
	X Walk 1 Direction	To SW		X Wa	lk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Wa	lk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.1		X Wa	lk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.5		X Wa	lk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ram	inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear	Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear	Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storn	n Grate/Utility Hazard?	N/A
	Obstruction Type			Storn	n Grate/Utility Type	
		N/A				N/A
			Yes	Surfa	ce Condition? (G/P)	Good



