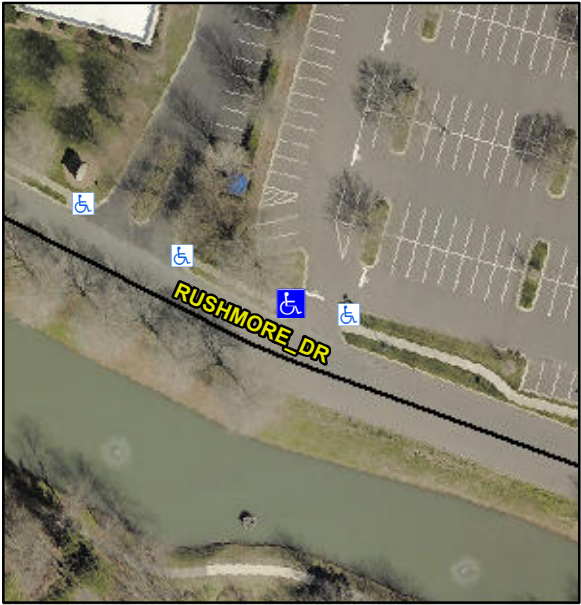


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|   |                          |   |                        |
|---|--------------------------|---|------------------------|
| Intersection ID: 10036601               | Main Street: RUSHMORE_DR | Cross Street: N/A                       | Location: NW           |
| ADA ID: 598F4414161D                    | Ramp Type: PerpDiag      | Initial Pass/Fail: Fail                 | Overall Compliance: No |
| Codes/Mitigation Info/Possible Solution |                          | Field Measurements/Component Compliance |                        |

|   |  |            |                       |       |            |                             |       |
|---|--|------------|-----------------------|-------|------------|-----------------------------|-------|
|         | Possible Solutions:  | Compliance | Description           | Data  | Compliance | Description                 | Data  |
|   | Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. | N/A        | Ramp Length (in)      | 95.0  | Yes        | Ramp Slope (%)              | 5.1   |
|   |  | No         | Ramp Width (in)       | 46.0  | No         | Ramp XSlope (%)             | 3.8   |
|   |  | N/A        | Flare Type LT         | N/A   | N/A        | Flare Type RT               | N/A   |
|   |  | N/A        | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A   |
|   |  | N/A        | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A   |
|   |  | N/A        | Landing Length (in)   | N/A   | N/A        | DWS Provided?               | N/A   |
|   |  | N/A        | Landing Width (in)    | N/A   | N/A        | DWS Contrast?               | N/A   |
|   |  | N/A        | Landing Slope (%)     | N/A   | N/A        | DWS Length (in)             | N/A   |
|   |  | N/A        | Landing X Slope (%)   | N/A   | N/A        | DWS Full Width?             | N/A   |
|   |  | N/A        | Landing Curb? (Y/N)   | N/A   | N/A        | DWS Offset (in)             | N/A   |
|   |  | N/A        | Shared Landing?       | N/A   |            |                             |       |
|   |  | N/A        | Gutter Ponding?       | N/A   | N/A        | Gutter Slope (%)            | N/A   |
|   |  | N/A        | Gutter Lip Ht (in)    | N/A   | N/A        | Gutter X Slope (%)          | N/A   |
|   |  | N/A        | Painted X Walk1?      | No    | N/A        | Painted X Walk2?            | No    |
|   |  |            | X Walk 1 Direction    | To SW |            | X Walk 2 Direction          | To SE |
|   |  | N/A        | X Walk 1 Width (in)   | N/A   | N/A        | X Walk 2 Width (in)         | N/A   |
|   |  |            | X Walk 1 Slope (%)    | 2.6   |            | X Walk 2 Slope (%)          | 3.0   |
|   |  |            | X Walk 1 X Slope (%)  | 1.8   |            | X Walk 2 X Slope (%)        | 2.0   |
|   |  | N/A        | Ramp inside XWalk1?   | N/A   | N/A        | Ramp inside XWalk2?         | N/A   |
| <p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.5.3</p> |  |            | Road Slope (%)        | 2.0   | N/A        | Clear Space?                | N/A   |
|   |  |            | Road X Slope (%)      | 4.8   | N/A        | Clear Space to XWalk (in)   | N/A   |
|   |  | N/A        | Any Obstructions?     | N/A   | N/A        | Storm Grate/Utility Hazard? | N/A   |
|   |  |            | Obstruction Type      |       |            | Storm Grate/Utility Type    |       |
|   |  |            |                       | N/A   |            |                             | N/A   |
|   |  |            |                       |       | Yes        | Surface Condition? (G/P)    | Good  |

|                         |             |
|-------------------------|-------------|
| Street 1 Name           | RUSHMORE DR |
| Stop Condition-Street 2 | None        |
| Street 2 Name           | ENTRANCE    |
| Stop Condition-Street 1 | StopSign    |

Total Cost: \$ 3200.00

