Access Compliance Report
Public Rights-of-Way
(Curb Ramps)

cole®

CHARLOTTE.

Intersection ID: 46481	Main Street: REVENNA_LN	Cross Street: BERKELEY_PLACE_DR	Location:	W
ADA ID: 59BE1C1BF4B0	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 13.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
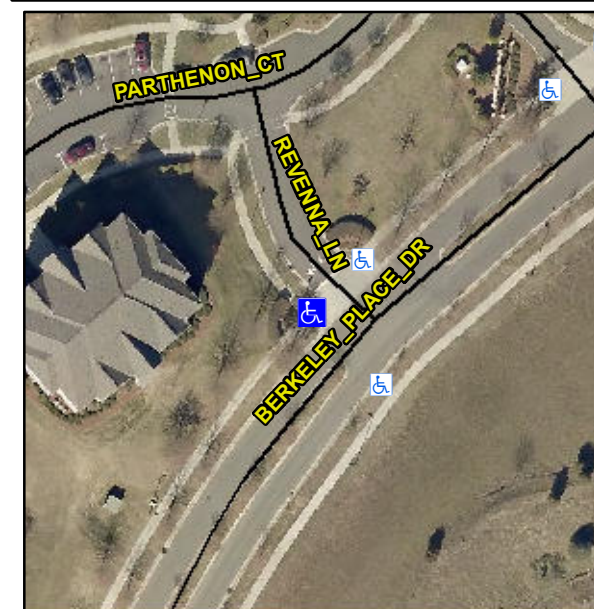
Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2, R304.5.3

Street 1 Name	**BERKELEY DR**
Stop Condition-Street 2	**None**
Street 2 Name	**REVENNA LN**
Stop Condition-Street 1	**StopSign**

Total Cost: **$ 3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	85.0	No	Ramp Slope (%)	9.0
Yes	Ramp Width (in)	61.0	No	Ramp XSlope (%)	3.6
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.8		X Walk 2 Slope (%)	3.1
	X Walk 1 X Slope (%)	3.1		X Walk 2 X Slope (%)	2.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.1	N/A	Clear Space?	N/A
	Road X Slope (%)	2.7	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
N/A					N/A
			Yes	Surface Condition? (G/P)	Good