


Intersection ID: 10025941		Main Street: ELLISON_ST	Cross Street: WACO_ST	Location:		N
ADA ID: 5AE89F93282A		Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	22.5
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
		Possible Solutions: Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	Compliance	Description	Data	
			N/A	Ramp Length (in)	69.0	No
			No	Ramp Width (in)	46.5	No
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	N/A	N/A
			N/A	Landing Width (in)	N/A	N/A
			N/A	Landing Slope (%)	N/A	N/A
			N/A	Landing X Slope (%)	N/A	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	
			N/A	Gutter Ponding?	N/A	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To SW	
			N/A	X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	2.8	
				X Walk 1 X Slope (%)	0.4	
			N/A	Ramp inside XWalk1?	N/A	N/A
				Road Slope (%)	1.4	N/A
				Road X Slope (%)	4.9	N/A
			N/A	Any Obstructions?	N/A	N/A
				Obstruction Type		
					N/A	N/A
					Yes	Good
Surveyor Notes: N/A						
PROW/ADA: R304.5.1, R304.2.2, R304.5.3						
Total Cost:		\$	3200.00			
Street 1 Name		ELLISON ST				
Stop Condition-Street 2		None				
Street 2 Name		WACO ST				
Stop Condition-Street 1		None				

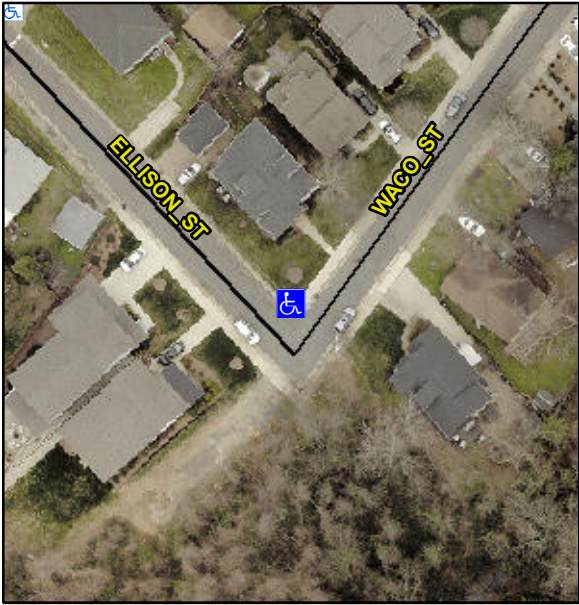