

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

|                        |                        |                                      |                        |
|------------------------|------------------------|--------------------------------------|------------------------|
| Intersection ID: 28386 | Main Street: MARVIN_RD | Cross Street: SOUTHAMPTON_COMMONS_DR | Location: S            |
| ADA ID: 5B1330BD10C8   | Ramp Type: PerpDiag    | Initial Pass/Fail: Fail              | Overall Compliance: No |
|                        |                        | Severity Score: 30                   |                        |

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

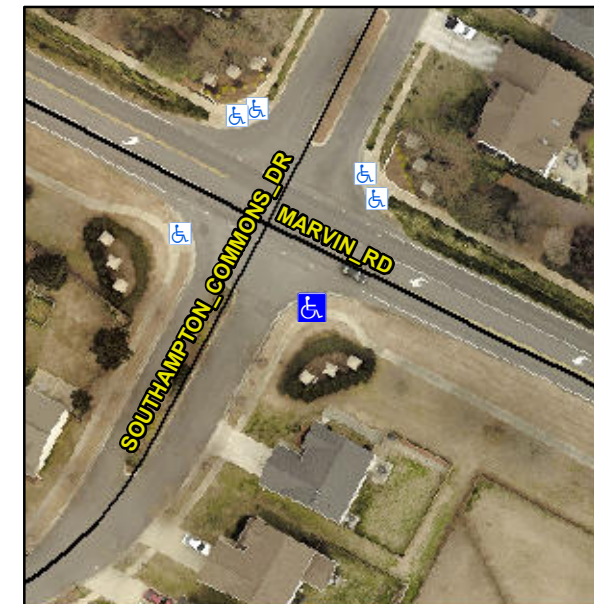

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.1, R304.5.3**

Total Cost: \$ 3200.00

| Compliance | Description           | Data  | Compliance | Description                 | Data  |
|------------|-----------------------|-------|------------|-----------------------------|-------|
| N/A        | Ramp Length (in)      | 71.0  | Yes        | Ramp Slope (%)              | 7.5   |
| No         | Ramp Width (in)       | 35.0  | No         | Ramp XSlope (%)             | 5.1   |
| N/A        | Flare Type LT         | N/A   | N/A        | Flare Type RT               | N/A   |
| N/A        | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A   |
| N/A        | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A   |
| N/A        | Landing Length (in)   | N/A   | N/A        | DWS Provided?               | N/A   |
| N/A        | Landing Width (in)    | N/A   | N/A        | DWS Contrast?               | N/A   |
| N/A        | Landing Slope (%)     | N/A   | N/A        | DWS Length (in)             | N/A   |
| N/A        | Landing X Slope (%)   | N/A   | N/A        | DWS Full Width?             | N/A   |
| N/A        | Landing Curb? (Y/N)   | N/A   | N/A        | DWS Offset (in)             | N/A   |
| N/A        | Shared Landing?       | N/A   |            |                             |       |
| N/A        | Gutter Ponding?       | N/A   | N/A        | Gutter Slope (%)            | N/A   |
| N/A        | Gutter Lip Ht (in)    | N/A   | N/A        | Gutter X Slope (%)          | N/A   |
| N/A        | Painted X Walk1?      | No    | N/A        | Painted X Walk2?            | No    |
|            | X Walk 1 Direction    | To NE |            | X Walk 2 Direction          | To NW |
| N/A        | X Walk 1 Width (in)   | N/A   | N/A        | X Walk 2 Width (in)         | N/A   |
|            | X Walk 1 Slope (%)    | 7.9   |            | X Walk 2 Slope (%)          | 1.2   |
|            | X Walk 1 X Slope (%)  | 0.8   |            | X Walk 2 X Slope (%)        | 4.8   |
| N/A        | Ramp inside XWalk1?   | N/A   | N/A        | Ramp inside XWalk2?         | N/A   |
|            | Road Slope (%)        | 4.6   | N/A        | Clear Space?                | N/A   |
|            | Road X Slope (%)      | 5.2   | N/A        | Clear Space to XWalk (in)   | N/A   |
| N/A        | Any Obstructions?     | N/A   | N/A        | Storm Grate/Utility Hazard? | N/A   |
|            | Obstruction Type      |       |            | Storm Grate/Utility Type    |       |
|            |                       | N/A   |            |                             | N/A   |
|            |                       |       | Yes        | Surface Condition? (G/P)    | Good  |

Street 1 Name **MARVIN RD**  
 Stop Condition-Street 2 **None**  
 Street 2 Name **SOUTHAMPTON COMMONS DR**  
 Stop Condition-Street 1 **StopSign**

