


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 32013 Main Street: RIDGE_CREK_DR Cross Street: GENERAL_DR Location: NW
ADA ID: 5B5FC749CF36 Ramp Type: Combination1Diag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

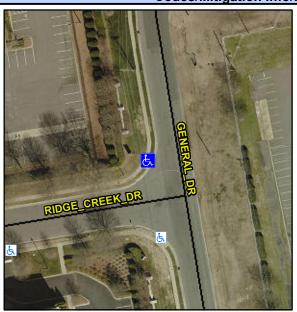

Street 1 Name
Stop Condition-Street 1
Street 2 Name
Stop Condition-Street 2

StopSign RIDGE CREEK DR None GENERAL DR Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

Not Found, R304.5.1, R304.5.3

Total Cost: \$ 3200.00

ricia incusarcinents/component compnance							
Compliance Description		Data	Comp	liance	Description	Da	ta
N/A	Ramp Length LT (in)	46.0	N/A	Ramp	Length RT (in)	50	0.0
No	Ramp Width LT (in)	47.0	No	Ramp	Width RT (in)	46	6.0
Yes	Ramp Slope LT (%)	3.8	Yes	Ramp	Slope RT (%)	5	5.3
Yes	Ramp XSlope LT (%)	1.0	Yes	Ramp	XSlope RT (%)	1	.8
N/A	Ramp Length (in)	48.0	Yes	Ramp	Slope (%)	3	3.0
Yes	Ramp Width (in)	56.0	No	Ramp	XSlope (%)	4	1.3
N/A	Flare Type LT	N/A	N/A	Flare	Type RT	N.	/ A
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N.	/A
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N.	/ A
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N.	/A
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N.	/A
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N.	/ A
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N.	/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N.	/ A
N/A	Shared Landing?	N/A					
N/A	Gutter Ponding?	N/A	N/A	Gutte	r Slope (%)	N	/ A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	r X Slope (%)	N.	/ A
N/A	Painted X Walk1?	No	N/A	Painte	ed X Walk2?	N	No
	X Walk 1 Direction	To S		X Wa	lk 2 Direction	То	E
	X Walk 1 Width (in)	N/A		X Wa	lk 2 Width (in)	N.	/A

1.0

0.9

N/A

0.6

0.9

N/A

N/A







N/A

X Walk 1 Slope (%)

X Walk 1 X Slope (%)

Ramp inside XWalk1?

Road Slope (%)

N/A Any Obstruction?

Obstruction Type

N/A

N/A

Storm Grate/Utility Hazard?

Storm Grate/Utility Type

N/A

Yes Surface Condition? (G/P)

Curb Slope (%)

11.9

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space to XWalk (in)

Clear Space?

2.6

0.3

N/A

N/A

N/A