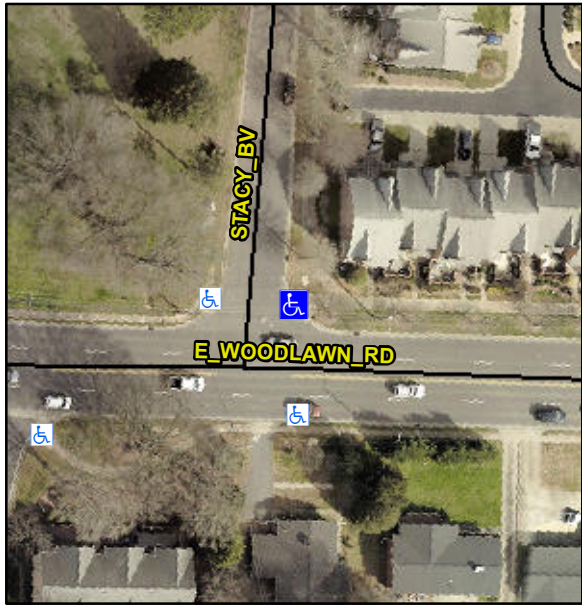


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 18108	Main Street: E_WOODLAWN_RD	Cross Street: STACY_BV	Location: NE
ADA ID: 5B7A6CE56A1D	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 8.75	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance								
	Possible Solutions:	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Compliance	Description	Data	Compliance	Description	Data	
	Surveyor Notes:	N/A	PROW/ADA:	Not Found, R304.5.1	N/A	Ramp Length (in)	125.0	Yes	Ramp Slope (%)	7.0
					No	Ramp Width (in)	43.0	Yes	Ramp XSlope (%)	1.1
					N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
	Total Cost:	\$	3200.00	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
N/A				Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
N/A				Shared Landing?	N/A					
N/A				Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
N/A				Gutter Lip Ht (in)	1.0	N/A	Gutter X Slope (%)	N/A		
N/A				Painted X Walk1?	No	N/A	Painted X Walk2?	No		
				X Walk 1 Direction	To W		X Walk 2 Direction	To S		
N/A				X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
				X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	0.2		
				X Walk 1 X Slope (%)	1.1		X Walk 2 X Slope (%)	1.0		
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A					
	Road Slope (%)	0.5	N/A	Clear Space?	N/A					
	Road X Slope (%)	0.0	N/A	Clear Space to XWalk (in)	N/A					
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A					
	Obstruction Type			Storm Grate/Utility Type						
			N/A		N/A					
			Yes	Surface Condition? (G/P)	Good					

Total Cost: \$ 3200.00

