

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

|                           |                                |                         |                        |
|---------------------------|--------------------------------|-------------------------|------------------------|
| Intersection ID: 10025931 | Main Street: ELLINGTON_PARK_DR | Cross Street: N/A       | Location: NW           |
| ADA ID: 5BFE7C1CED3D      | Ramp Type: BlendTrans2         | Initial Pass/Fail: Fail | Overall Compliance: No |
|                           |                                | Severity Score: 15      |                        |

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

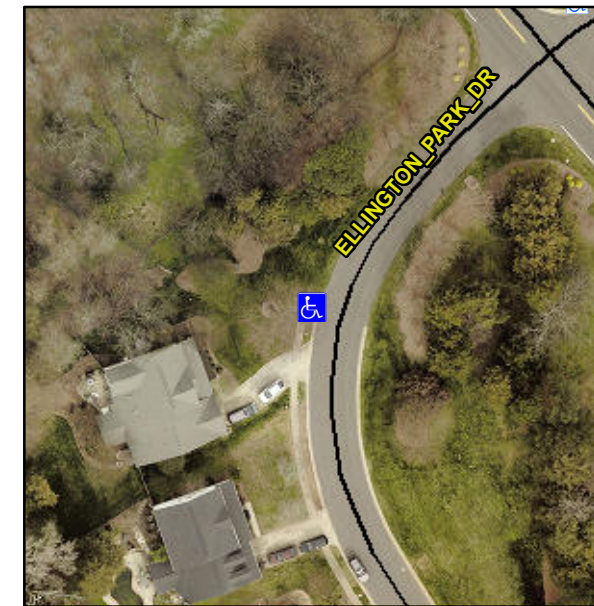

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R302.7**

Total Cost: \$ 3200.00

| Compliance | Description           | Data  | Compliance | Description                 | Data |
|------------|-----------------------|-------|------------|-----------------------------|------|
| N/A        | Ramp Length (in)      | 103.0 | Yes        | BlendTrans Slope (%)        | 2.2  |
| Yes        | Ramp Width (in)       | 70.0  | Yes        | BlendTrans XSlope (%)       | 0.4  |
| N/A        | Flare Type LT         | N/A   | N/A        | Flare Type RT               | N/A  |
| N/A        | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A  |
| N/A        | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A  |
| N/A        | Landing Length (in)   | N/A   | N/A        | DWS Provided?               | N/A  |
| N/A        | Landing Width (in)    | N/A   | N/A        | DWS Contrast?               | N/A  |
| N/A        | Landing Slope (%)     | N/A   | N/A        | DWS Length (in)             | N/A  |
| N/A        | Landing X Slope (%)   | N/A   | N/A        | DWS Full Width?             | N/A  |
| N/A        | Landing Curb? (Y/N)   | N/A   | N/A        | DWS Offset (in)             | N/A  |
| N/A        | Shared Landing?       | N/A   |            |                             |      |
| N/A        | Gutter Ponding?       | N/A   | N/A        | Gutter Slope (%)            | N/A  |
| N/A        | Gutter Lip Ht (in)    | N/A   | N/A        | Gutter X Slope (%)          | N/A  |
| N/A        | Painted X Walk1?      | No    | N/A        | Painted X Walk2?            | N/A  |
|            | X Walk 1 Direction    | To NE |            | X Walk 2 Direction          | N/A  |
|            | X Walk 1 Width (in)   | N/A   |            | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)    | 2.8   |            | X Walk 2 Slope (%)          | N/A  |
|            | X Walk 1 X Slope (%)  | 1.5   |            | X Walk 2 X Slope (%)        | N/A  |
| N/A        | Ramp inside XWalk1?   | N/A   | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)        | 1.5   |            | Clear Space?                | N/A  |
|            | Road X Slope (%)      | 2.8   | N/A        | Clear Space to XWalk (in)   | N/A  |
| N/A        | Any Obstructions?     | N/A   | N/A        | Storm Grate/Utility Hazard? | N/A  |
|            | Obstruction Type      |       |            | Storm Grate/Utility Type    |      |
|            |                       | N/A   |            |                             | N/A  |
|            |                       |       | No         | Surface Condition? (G/P)    | Poor |
|            |                       |       | No         | Curb Slope (%)              | 17.4 |

Street 1 Name ELLINGTON PARK DR

Stop Condition-Street 1 None

Street 2 Name N/A

Stop Condition-Street 2 N/A

