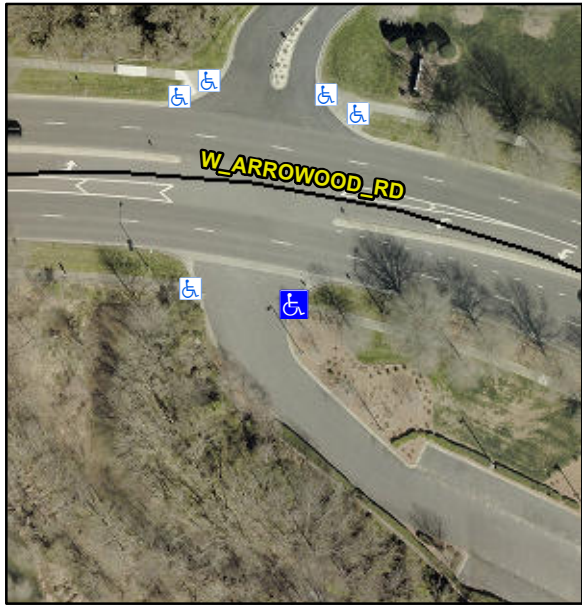


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

| | | | | | | | | | | | | | | | | | |
|--|--|-----------------------------|--|---|--|------------------------|--|-----------------------|--|------|--|------------|--|-----------------------------|--|------|--|
| Intersection ID: 10040584 | | Main Street: W_ARROWWOOD_RD | | Cross Street: N/A | | Location: | | SE | | | | | | | | | |
| ADA ID: 5C034B7CAB46 | | Ramp Type: Directional1 | | Initial Pass/Fail: Fail | | Overall Compliance: No | | Severity Score: 1.25 | | | | | | | | | |
| Codes/Mitigation Info/Possible Solution | | | | Field Measurements/Component Compliance | | | | | | | | | | | | | |
|  | | | | Possible Solutions: | | Compliance | | Description | | Data | | Compliance | | Description | | Data | |
| | | | | Remove & Replace Entire Ramp. | | N/A | | Ramp Length (in) | | 26.0 | | N/A | | Grade Break? | | N/A | |
| Surveyor Notes: | | | | N/A | | Yes | | Ramp Width (in) | | 60.0 | | N/A | | Grade Break Slope (%) | | 0.0 | |
| | | | | | | Yes | | Ramp Slope (%) | | 3.4 | | N/A | | Grade Break XSlope (%) | | 0.0 | |
| PROW/ADA: | | | | R304.5.3 | | No | | Ramp XSlope (%) | | 5.0 | | N/A | | Flare Type RT | | N/A | |
| | | | | | | N/A | | Flare Type LT | | N/A | | N/A | | Flare Slope RT (%) | | 0.0 | |
| | | | | | | N/A | | Flare Slope LT (%) | | N/A | | N/A | | Flare Slope LT (%) | | 0.0 | |
| | | | | | | N/A | | Flare Traversable LT? | | N/A | | N/A | | Flare Traversable RT? | | N/A | |
| | | | | | | N/A | | Landing Length (in) | | 0.0 | | N/A | | DWS Provided? | | N/A | |
| | | | | | | N/A | | Landing Width (in) | | 0.0 | | N/A | | DWS Contrast? | | N/A | |
| | | | | | | N/A | | Landing Slope (%) | | 0.0 | | N/A | | DWS Length (in) | | N/A | |
| | | | | | | N/A | | Landing X Slope (%) | | 0.0 | | N/A | | DWS Full Width? | | N/A | |
| | | | | | | N/A | | Landing Curb? (Y/N) | | N/A | | N/A | | DWS Offset LT (in) | | N/A | |
| | | | | | | N/A | | Shared Landing? | | N/A | | N/A | | DWS Offset RT (in) | | N/A | |
| | | | | | | N/A | | Gutter Ponding? | | 0.0 | | N/A | | Gutter Slope (%) | | N/A | |
| | | | | | | N/A | | Gutter Lip Ht (in) | | 0.0 | | N/A | | Gutter X Slope (%) | | N/A | |
| | | | | | | N/A | | Painted X Walk1? | | No | | | | Road Slope (%) | | 2.6 | |
| | | | | | | | | X Walk 1 Direction | | To W | | | | Road X Slope (%) | | 4.0 | |
| | | | | | | | | X Walk 1 Width (in) | | N/A | | | | Clear Space? | | N/A | |
| | | | | | | | | X Walk 1 Slope (%) | | 2.6 | | N/A | | Clear Space to XWalk (in) | | N/A | |
| | | | | | | | | X Walk 1 X Slope (%) | | 4.0 | | N/A | | Storm Grate/Utility Hazard? | | N/A | |
| | | | | | | N/A | | Ramp inside XWalk1? | | N/A | | | | Storm Grate/Utility Type | | | |
| | | | | | | N/A | | Any Obstructions? | | N/A | | | | | | N/A | |
| | | | | | | | | Obstruction Type | | | | Yes | | Surface Condition? (G/P) | | Good | |
| | | | | | | | | | | N/A | | N/A | | Curb Slope (%) | | 13.1 | |
| | | | | | | | | | | | | | | | | | |
| Street 1 Name | | | | ENTRANCE | | | | | | | | | | | | | |
| Stop Condition-Street 1 | | | | StopSign | | | | | | | | | | | | | |
| Street 2 Name | | | | N/A | | | | | | | | | | | | | |
| Stop Condition-Street 2 | | | | N/A | | | | | | | | | | | | | |
| Total Cost: | | | | \$ | | 1600.00 | | | | | | | | | | | |

| | |
|-------------------------|----------|
| Street 1 Name | ENTRANCE |
| Stop Condition-Street 1 | StopSign |
| Street 2 Name | N/A |
| Stop Condition-Street 2 | N/A |

