


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: NATIONS_FORD_RD	Cross Street: N/A	Location: E
ADA ID: 5C5D96FC9E7C	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 0.25			

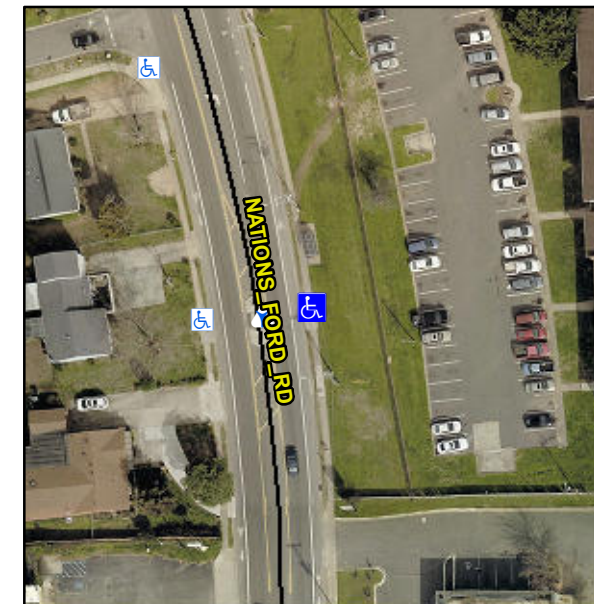

Possible Solutions:

**Remove & Replace Entire Ramp.
Gutter Ponding Observed.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R302.7

Total Cost: \$ 2100.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	75.0	N/A	Ramp Length RT (in)	74.0
Yes	Ramp Width LT (in)	64.5	Yes	Ramp Width RT (in)	63.0
Yes	Ramp Slope LT (%)	7.0	Yes	Ramp Slope RT (%)	7.7
Yes	Ramp XSlope LT (%)	1.6	No	Ramp XSlope RT (%)	3.6
Yes	Landing Length (in)	63.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.4	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	Yes	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	0.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	9.3

