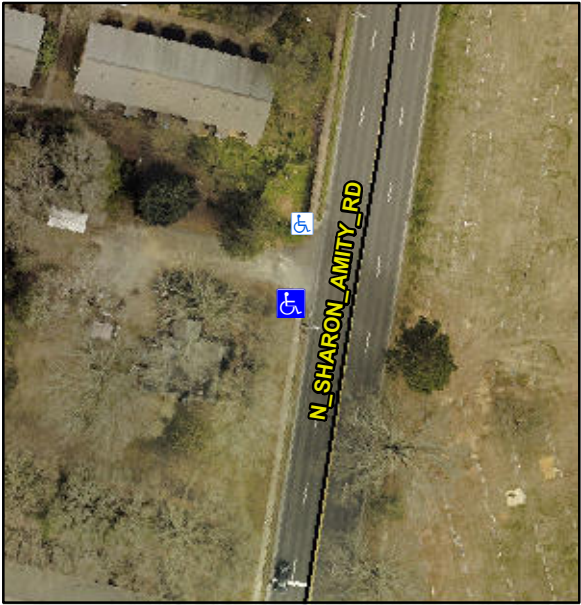


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                                         |                                |                                         |                        |
|-----------------------------------------|--------------------------------|-----------------------------------------|------------------------|
| Intersection ID: 10032734               | Main Street: N_SHARON_AMITY_RD | Cross Street: N/A                       | Location: SW           |
| ADA ID: 5C669381F77D                    | Ramp Type: PerpDiag            | Initial Pass/Fail: Fail                 | Overall Compliance: No |
| Severity Score: 13.75                   |                                |                                         |                        |
| Codes/Mitigation Info/Possible Solution |                                | Field Measurements/Component Compliance |                        |

|                                                                                         |                                                                          |            |                       |         |            |                             |       |
|-----------------------------------------------------------------------------------------|--------------------------------------------------------------------------|------------|-----------------------|---------|------------|-----------------------------|-------|
|         | Possible Solutions:                                                      | Compliance | Description           | Data    | Compliance | Description                 | Data  |
|                                                                                         | Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. | N/A        | Ramp Length (in)      | 62.0    | No         | Ramp Slope (%)              | 11.9  |
|                                                                                         |                                                                          | Yes        | Ramp Width (in)       | 48.0    | No         | Ramp XSlope (%)             | 3.1   |
|                                                                                         |                                                                          | N/A        | Flare Type LT         | N/A     | N/A        | Flare Type RT               | N/A   |
|                                                                                         |                                                                          | N/A        | Flare Slope LT (%)    | N/A     | N/A        | Flare Slope RT (%)          | N/A   |
|                                                                                         |                                                                          | N/A        | Flare Traversable LT? | N/A     | N/A        | Flare Traversable RT?       | N/A   |
|                                                                                         |                                                                          | N/A        | Landing Length (in)   | N/A     | N/A        | DWS Provided?               | N/A   |
|                                                                                         |                                                                          | N/A        | Landing Width (in)    | N/A     | N/A        | DWS Contrast?               | N/A   |
|                                                                                         |                                                                          | N/A        | Landing Slope (%)     | N/A     | N/A        | DWS Length (in)             | N/A   |
|                                                                                         |                                                                          | N/A        | Landing X Slope (%)   | N/A     | N/A        | DWS Full Width?             | N/A   |
|                                                                                         |                                                                          | N/A        | Landing Curb? (Y/N)   | N/A     | N/A        | DWS Offset (in)             | N/A   |
|                                                                                         |                                                                          | N/A        | Shared Landing?       | N/A     |            |                             |       |
|                                                                                         |                                                                          | N/A        | Gutter Ponding?       | N/A     | N/A        | Gutter Slope (%)            | N/A   |
|                                                                                         |                                                                          | N/A        | Gutter Lip Ht (in)    | N/A     | N/A        | Gutter X Slope (%)          | N/A   |
|                                                                                         |                                                                          | N/A        | Painted X Walk1?      | No      | N/A        | Painted X Walk2?            | No    |
|                                                                                         |                                                                          |            | X Walk 1 Direction    | To SE   |            | X Walk 2 Direction          | To NE |
|                                                                                         |                                                                          | N/A        | X Walk 1 Width (in)   | N/A     | N/A        | X Walk 2 Width (in)         | N/A   |
|                                                                                         |                                                                          |            | X Walk 1 Slope (%)    | 3.6     |            | X Walk 2 Slope (%)          | 6.5   |
|                                                                                         |                                                                          |            | X Walk 1 X Slope (%)  | 7.4     |            | X Walk 2 X Slope (%)        | 0.9   |
|                                                                                         |                                                                          | N/A        | Ramp inside XWalk1?   | N/A     | N/A        | Ramp inside XWalk2?         | N/A   |
| <p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.2.2, R304.5.3</p> |                                                                          |            | Road Slope (%)        | 2.9     | N/A        | Clear Space?                | N/A   |
|                                                                                         |                                                                          |            | Road X Slope (%)      | 4.3     | N/A        | Clear Space to XWalk (in)   | N/A   |
|                                                                                         |                                                                          | N/A        | Any Obstructions?     | N/A     | N/A        | Storm Grate/Utility Hazard? | N/A   |
|                                                                                         |                                                                          |            | Obstruction Type      |         |            | Storm Grate/Utility Type    |       |
| Total Cost:                                                                             |                                                                          |            | \$                    | 3200.00 | N/A        |                             | N/A   |
|                                                                                         |                                                                          |            |                       |         | Yes        | Surface Condition? (G/P)    | Good  |

