

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 29405	Main Street: GOLD_PAN_RD	Cross Street: REEDY_PLANTATION_RD	Location: SE
ADA ID: 5C945CF77752	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

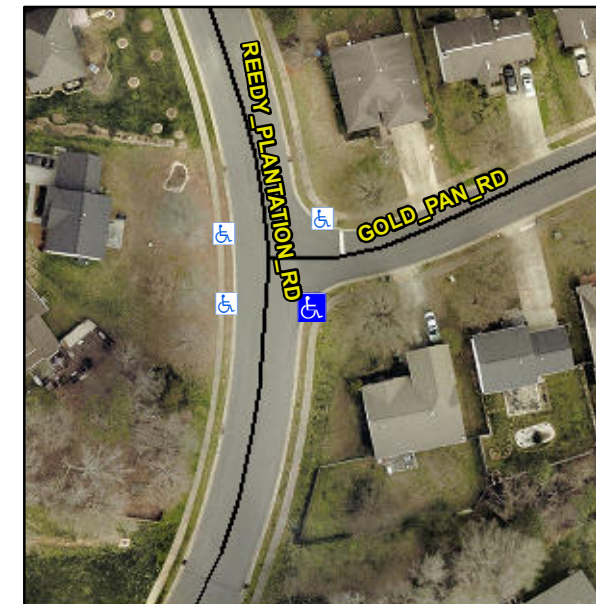

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.1, R305.2**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	53.5	Yes	BlendTrans Slope (%)	1.7
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	2.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	3.9	N/A	Flare Slope RT (%)	2.8
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	46.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.6		X Walk 2 Slope (%)	4.0
	X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	3.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.4		Clear Space?	Yes
	Road X Slope (%)	5.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	13.7

Street 1 Name GOLD PAN RD

Stop Condition-Street 1 StopSign

Street 2 Name REEDY PLANTATION RD

Stop Condition-Street 2 None

