


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: GLEN_LAKE_DR	Cross Street: CASCADE_POINTE_BV	Location: SE
ADA ID: 5CEC934878CA	Ramp Type: MedianPerp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 10			

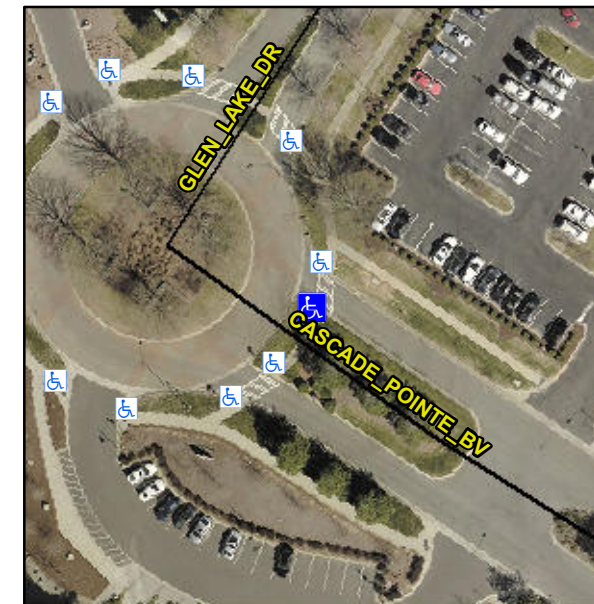

Possible Solutions:

**Remove & Replace Entire Ramp.  
Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-  
Para, R305, R304.5.3**

Total Cost: \$ 2400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	263.0	Yes	Ramp Slope (%)	6.8
Yes	Ramp Width (in)	59.0	Yes	Ramp XSlope (%)	2.0
N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	80.0	No	DWS Provided?	No
Yes	Landing Width (in)	60.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	2.8	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	1.2	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.4
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.6
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	93.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.6		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

