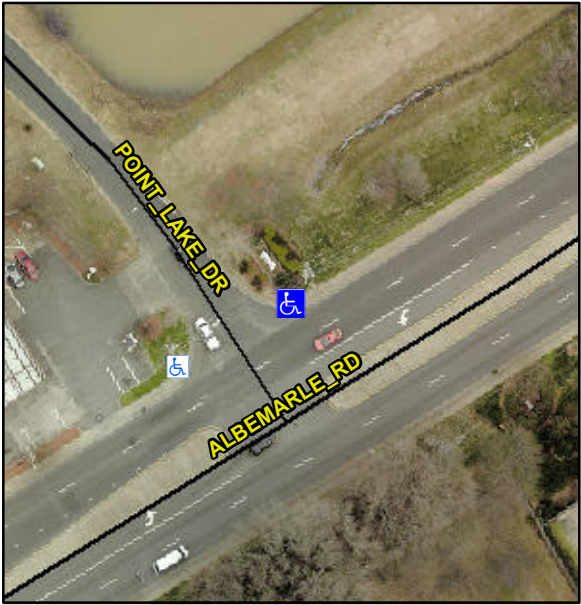


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 15079	Main Street: ALBEMARLE_RD	Cross Street: POINT_LAKE_DR	Location:	N
ADA ID: 5D67514173BA	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		No	Ramp Length (in)	61.0
			No	Ramp Width (in)	47.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
Surveyor Notes: N/A PROW/ADA: Not Found, R304.5.1, R304.2.2			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
Total Cost: \$ 1850.00			No	Painted X Walk1?	N/A
			To W	X Walk 1 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A
			4.3	X Walk 1 Slope (%)	N/A
			4.6	X Walk 1 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	N/A
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good

