

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10025537	Main Street: E_STONEWALL_ST	Cross Street: N/A	Location: SE
ADA ID: 5DA04DAEA013	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 7.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

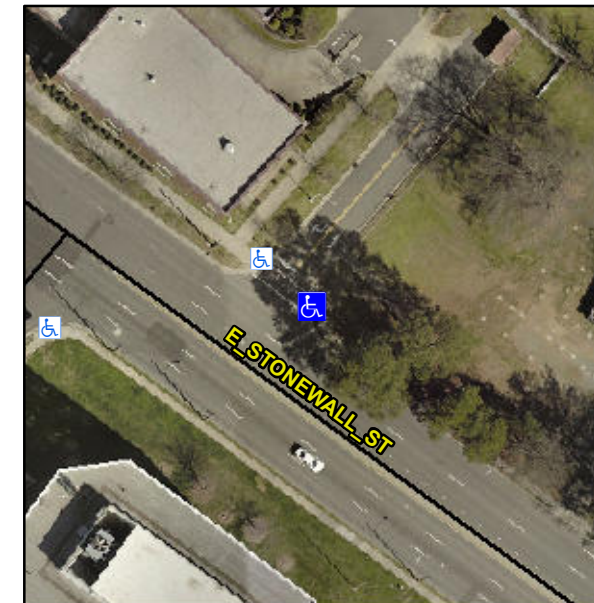

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R305.2, R302.7.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	72.0	Yes	Ramp Slope (%)	6.9
Yes	Ramp Width (in)	85.0	Yes	Ramp XSlope (%)	0.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	2.8	N/A	Flare Slope RT (%)	5.5
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	54.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	85.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.8	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	6.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.8
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	1.2
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	98.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.4		X Walk 2 Slope (%)	2.6
	X Walk 1 X Slope (%)	1.7		X Walk 2 X Slope (%)	0.0
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.1	N/A	Clear Space?	Yes
	Road X Slope (%)	1.5	N/A	Clear Space to XWalk (in)	30.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name **ENTRANCE**
 Stop Condition-Street 2 **StopSign**
 Street 2 Name **E STONEWALL ST**
 Stop Condition-Street 1 **None**

