


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: N/A	Main Street: PINEVILLE-MATTHEWS_RD	Cross Street: KETTERING_DR	Location: NE
ADA ID: 5E39409AB587	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No Severity Score: 12.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

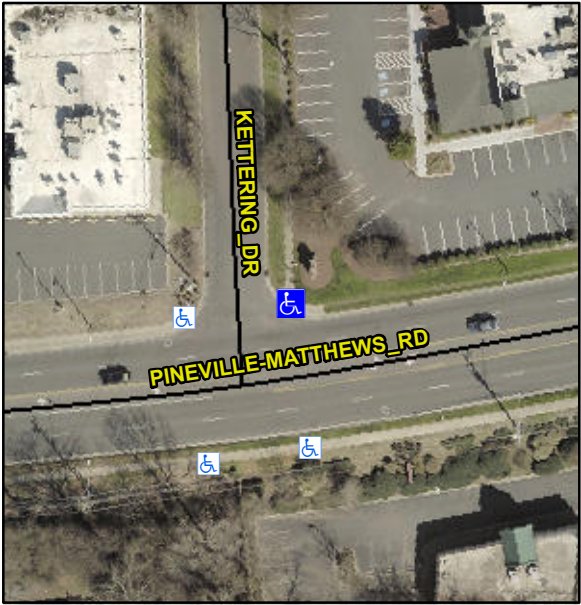

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
N/A

PROW/ADA:
R304.2.2

Street 1 Name: **KETTERING DR**
 Stop Condition-Street 2: **StopSign**
 Street 2 Name: **PINEVILLE-MATTHEWS RD**
 Stop Condition-Street 1: **None**

Total Cost: \$ **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	57.5	No	Ramp Slope (%)	9.8
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.1
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	1.1
	X Walk 1 X Slope (%)	0.6		X Walk 2 X Slope (%)	3.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.7	N/A	Clear Space?	N/A
	Road X Slope (%)	4.1	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

