

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

|                        |                             |                                |                        |
|------------------------|-----------------------------|--------------------------------|------------------------|
| Intersection ID: 29795 | Main Street: BRISTLE_TOE_LN | Cross Street: CHELTON_RIDGE_LN | Location: NE           |
| ADA ID: 5E63BDEAFC9A   | Ramp Type: Combination1Diag | Initial Pass/Fail: Fail        | Overall Compliance: No |
|                        |                             | Severity Score: 0              |                        |

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

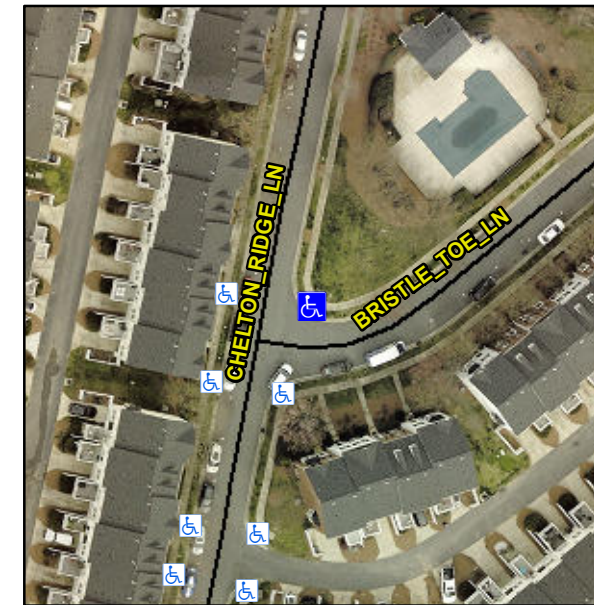

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**LT RP < 5%**

PROW/ADA:

**R304.5.1, R304.2.2, R304.5.3**

Total Cost:

**\$ 3200.00**

| Compliance | Description              | Data | Compliance | Description                 | Data |
|------------|--------------------------|------|------------|-----------------------------|------|
| N/A        | Ramp Length LT (in)      | 40.0 | N/A        | Ramp Length RT (in)         | 33.5 |
| Yes        | Ramp Width LT (in)       | 48.0 | Yes        | Ramp Width RT (in)          | 51.0 |
| Yes        | Ramp Slope LT (%)        | 4.7  | Yes        | Ramp Slope RT (%)           | 7.6  |
| No         | Ramp XSlope LT (%)       | 5.7  | Yes        | Ramp XSlope RT (%)          | 1.6  |
| N/A        | Ramp Length (in)         | 84.0 | No         | Ramp Slope (%)              | 9.0  |
| No         | Ramp Width (in)          | 39.0 | No         | Ramp XSlope (%)             | 6.4  |
| N/A        | Flare Type LT            | N/A  | N/A        | Flare Type RT               | N/A  |
| N/A        | Flare Slope LT (%)       | N/A  | N/A        | Flare Slope RT (%)          | N/A  |
| N/A        | Flare Traversable LT?    | N/A  | N/A        | Flare Traversable RT?       | N/A  |
| N/A        | Landing Length (in)      | N/A  | N/A        | DWS Provided?               | N/A  |
| N/A        | Landing Width (in)       | N/A  | N/A        | DWS Contrast?               | N/A  |
| N/A        | Landing Slope (%)        | N/A  | N/A        | DWS Length (in)             | N/A  |
| N/A        | Landing X Slope (%)      | N/A  | N/A        | DWS Full Width?             | N/A  |
| N/A        | Landing Curb? (Y/N)      | N/A  | N/A        | DWS Offset (in)             | N/A  |
| N/A        | Shared Landing?          | N/A  |            |                             |      |
| N/A        | Gutter Ponding?          | N/A  | N/A        | Gutter Slope (%)            | N/A  |
| N/A        | Gutter Lip Ht (in)       | N/A  | N/A        | Gutter X Slope (%)          | N/A  |
| N/A        | Painted X Walk1?         | No   | N/A        | Painted X Walk2?            | No   |
|            | X Walk 1 Direction       | To W |            | X Walk 2 Direction          | To S |
|            | X Walk 1 Width (in)      | N/A  |            | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)       | 2.2  |            | X Walk 2 Slope (%)          | 1.7  |
|            | X Walk 1 X Slope (%)     | 2.3  |            | X Walk 2 X Slope (%)        | 3.3  |
| N/A        | Ramp inside XWalk1?      | N/A  | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)           | 4.7  |            | Clear Space?                | N/A  |
|            | Road X Slope (%)         | 1.2  | N/A        | Clear Space to XWalk (in)   | N/A  |
|            |                          |      | N/A        | Any Obstruction?            | N/A  |
|            |                          |      |            | Obstruction Type            | N/A  |
|            |                          |      |            |                             |      |
|            |                          |      | N/A        | Storm Grate/Utility Hazard? | N/A  |
|            |                          |      |            | Storm Grate/Utility Type    | N/A  |
|            |                          |      |            |                             |      |
| Yes        | Surface Condition? (G/P) | Good |            |                             |      |
|            | Curb Slope (%)           | 1.7  |            |                             |      |

Street 1 Name **None**

Stop Condition-Street 1 **CHELTON RIDGE LN**

Street 2 Name **StopSign**

Stop Condition-Street 2 **BRISTLE TOE LN**

