


# Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 27189	Main Street: MCKEE_RD	Cross Street: PROVIDENCE_ARBOURS_DR	Location: NE
ADA ID: 5E997A64AB2A	Ramp Type: BlendTrans1	Initial Pass/Fail: Fail	Overall Compliance: No Severity Score: 21.25

### Codes/Mitigation Info/Possible Solution

### Field Measurements/Component Compliance

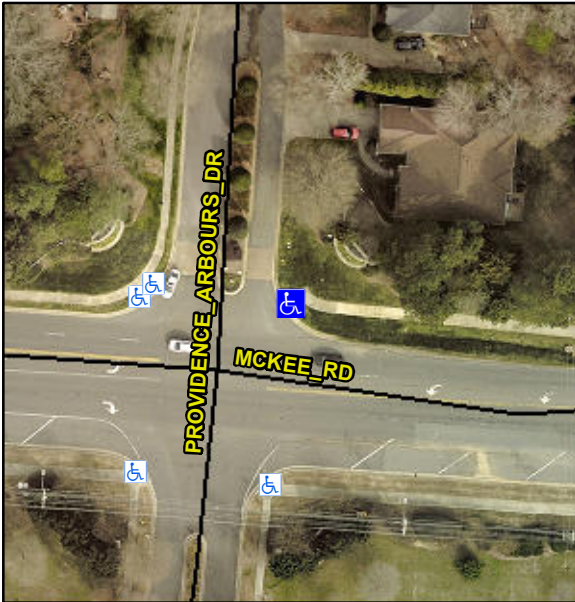

Possible Solutions:  
**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:  
**N/A**

PROW/ADA:  
**Not Found, R304.5.1, R304.5.3**

Street 1 Name           **PROVIDENCE ARBOURS DR**  
 Stop Condition-Street 1           **StopSign**  
 Street 2 Name           **MCKEE RD**  
 Stop Condition-Street 2           **None**

Total Cost:                               **\$   3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	96.0	Yes	BlendTrans Slope (%)	4.5
No	Ramp Width (in)	47.0	No	BlendTrans XSlope (%)	5.2
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	5.8
	X Walk 1 X Slope (%)	5.8		X Walk 2 X Slope (%)	0.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.5		Clear Space?	N/A
	Road X Slope (%)	3.8	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
Yes	Surface Condition? (G/P)		Yes		Good
No	Curb Slope (%)		No		7.6

