Access Compliance Report
Public Rights-of-Way
(Curb Ramps)

Intersection ID: 18944 **Main Street:** GULFSTREAM_CT **Cross Street:** CLIFTON_MEADOW_DR **Location:** S

ADA ID: 5ED9CBD5FAB5 **Ramp Type:** PerpDiag **Initial Pass/Fail:** Pass **Overall Compliance:** No **Severity Score:** 10.25

Codes/Mitigation Info/Possible Solution

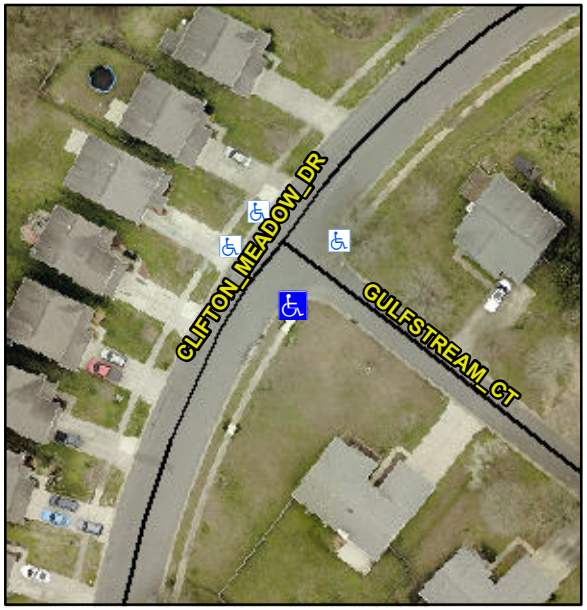

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para

Street 1 Name	GULFSTREAM CT
Stop Condition-Street 2	StopSign
Street 2 Name	CLIFTON MEADOW DR
Stop Condition-Street 1	None

Total Cost: $ 3200.00

Field Measurements/Component Compliance
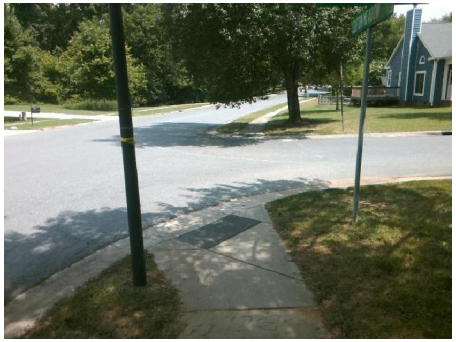
Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	32.0	Yes	Ramp Slope (%)	5.5
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.3
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	0.9	Yes	Flare Slope RT (%)	9.1
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	25.0
No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	N/A			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	0.7
	X Walk 1 X Slope (%)	2.1		X Walk 2 X Slope (%)	0.7
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.8	N/A	Clear Space?	Yes
	Road X Slope (%)	0.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good