


Intersection ID: 29377	Main Street: BUCKVALLEY_DR	Cross Street: EULER_WY	Location:	NW
ADA ID: 5F6AA6D5621A	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 8.75

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
	Possible Solutions:			Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.					
	Surveyor Notes:			N/A					
	PROW/ADA:			R304.5.1					
	Street 1 Name			BUCKVALLEY DR					
	Stop Condition-Street 2			StopSign					
	Street 2 Name			EULER WY					
	Stop Condition-Street 1			None					
	Total Cost:			\$ 3200.00					
Compliance		Description		Data	Compliance		Description		Data
N/A	Ramp Length (in)			94.5	Yes	Ramp Slope (%)			5.1
No	Ramp Width (in)			47.0	Yes	Ramp XSlope (%)			0.1
N/A	Flare Type LT			N/A	N/A	Flare Type RT			N/A
N/A	Flare Slope LT (%)			N/A	N/A	Flare Slope RT (%)			N/A
N/A	Flare Traversable LT?			N/A	N/A	Flare Traversable RT?			N/A
N/A	Landing Length (in)			N/A	N/A	DWS Provided?			N/A
N/A	Landing Width (in)			N/A	N/A	DWS Contrast?			N/A
N/A	Landing Slope (%)			N/A	N/A	DWS Length (in)			N/A
N/A	Landing X Slope (%)			N/A	N/A	DWS Full Width?			N/A
N/A	Landing Curb? (Y/N)			N/A	N/A	DWS Offset (in)			N/A
N/A	Shared Landing?			N/A					
N/A	Gutter Ponding?			N/A	N/A	Gutter Slope (%)			N/A
N/A	Gutter Lip Ht (in)			N/A	N/A	Gutter X Slope (%)			N/A
N/A	Painted X Walk1?			No	N/A	Painted X Walk2?			No
	X Walk 1 Direction			To S		X Walk 2 Direction			To E
N/A	X Walk 1 Width (in)			N/A	N/A	X Walk 2 Width (in)			N/A
	X Walk 1 Slope (%)			1.2		X Walk 2 Slope (%)			0.2
	X Walk 1 X Slope (%)			2.5		X Walk 2 X Slope (%)			0.3
N/A	Ramp inside XWalk1?			N/A	N/A	Ramp inside XWalk2?			N/A
	Road Slope (%)			2.0	N/A	Clear Space?			N/A
	Road X Slope (%)			3.8	N/A	Clear Space to XWalk (in)			N/A
N/A	Any Obstructions?			N/A	N/A	Storm Grate/Utility Hazard?			N/A
	Obstruction Type					Storm Grate/Utility Type			
				N/A					N/A
					Yes	Surface Condition? (G/P)			Good

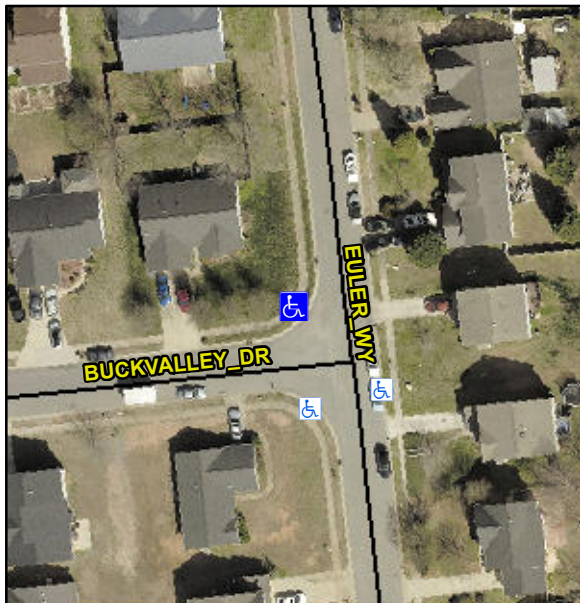