


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 7065	Main Street: EBARA_LN	Cross Street: KINGVILLE_DR	Location: SE
ADA ID: 5FA950D3AB4E	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 10
			Field Measurements/Component Compliance

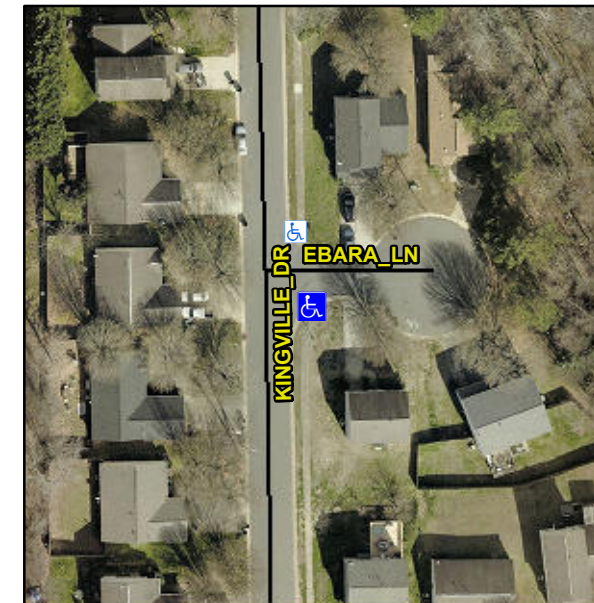

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

CURB GAP 1.0

PROW/ADA:

**Not Found, R304.2.1, R304.2.2-Perp,
R304.3.2-Para, R304.5.3, R305.1.4,
R302.7.2**

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	49.5	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	49.0	No	Grade Break Slope (%)	6.1
Yes	Ramp Slope (%)	6.1	Yes	Grade Break XSlope (%)	0.2
Yes	Ramp XSlope (%)	2.0			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
No	Landing Length (in)	30.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	49.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	6.4	Yes	DWS Length (in)	25.5
No	Landing X Slope (%)	2.2	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	20.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	1.5
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.6
No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	3.9
N/A	Painted X Walk1?	No		Road Slope (%)	1.3
	X Walk 1 Direction	To N		Road X Slope (%)	4.8
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	1.3	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	4.8	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	15.4

