

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 30214	Main Street: HIDDEN_CREEK_DR	Cross Street: MOSS_STREAM_LN	Location: S
ADA ID: 5FC4A7AA2E92	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 22.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

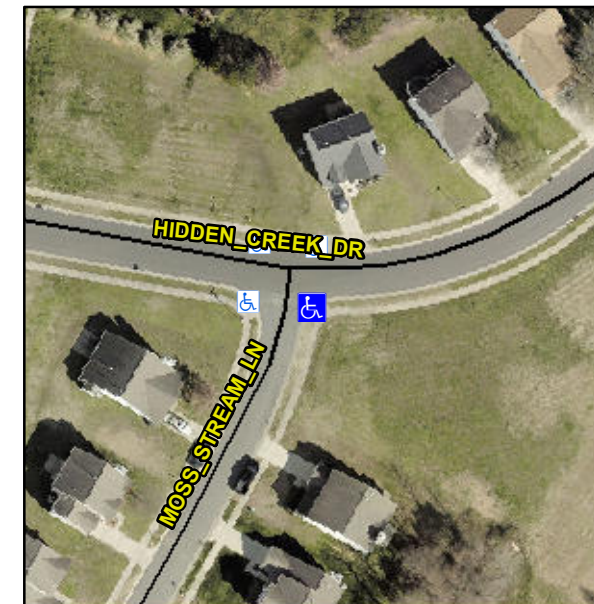

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.1, R305, R302.7.2, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	6.2
Yes	Ramp Width (in)	53.0	No	Ramp XSlope (%)	4.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	6.2	N/A	Flare Slope RT (%)	1.2
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	46.5	No	DWS Provided?	No
Yes	Landing Width (in)	104.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.4	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	6.4	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.1
No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	3.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.6		X Walk 2 Slope (%)	3.0
	X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	1.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.6	N/A	Clear Space?	Yes
	Road X Slope (%)	1.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name HIDDEN CREEK DR
 Stop Condition-Street 2 None
 Street 2 Name MOSS STEAM LN
 Stop Condition-Street 1 StopSign

