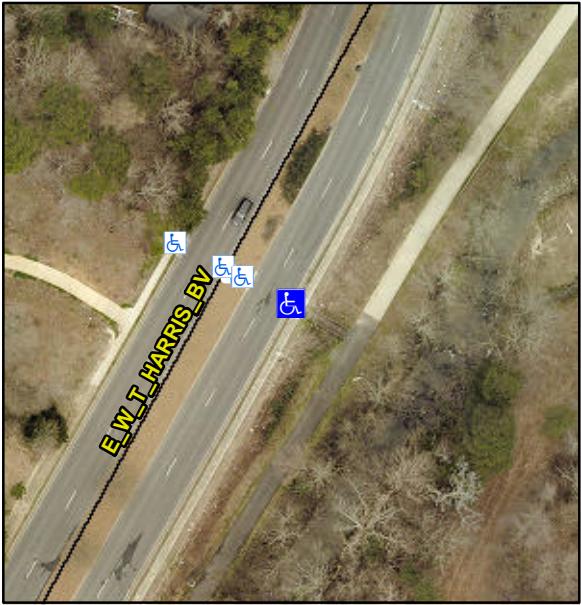



Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10025574	Main Street: E_W_T_HARRIS_BV	Cross Street: N/A	Location: SE
ADA ID: 6022D42DDBA7	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	85.0
			No	Ramp Width LT (in)	47.0
			Yes	Ramp Slope LT (%)	8.0
			Yes	Ramp XSlope LT (%)	1.1
			N/A	Ramp Length (in)	24.0
			Yes	Ramp Width (in)	59.0
	Surveyor Notes:		N/A	Flare Type LT	N/A
	N/A		N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
<p>PROW/ADA:</p> <p>R304.5.1, R304.2.2</p>			N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
<p>Total Cost:</p> <p>\$ 1800.00</p>			N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To NW
				X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	5.3
				X Walk 1 X Slope (%)	1.0
			N/A	Ramp inside XWalk1?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			N/A	Ramp inside XWalk2?	N/A
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
					N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
					N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	3.1