


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 5421	Main Street: SUNSET_RD	Cross Street: OLD_STATESVILLE_RD	Location:	N
ADA ID: 6044ECD25F83	Ramp Type: IslandPerp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 7.5
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

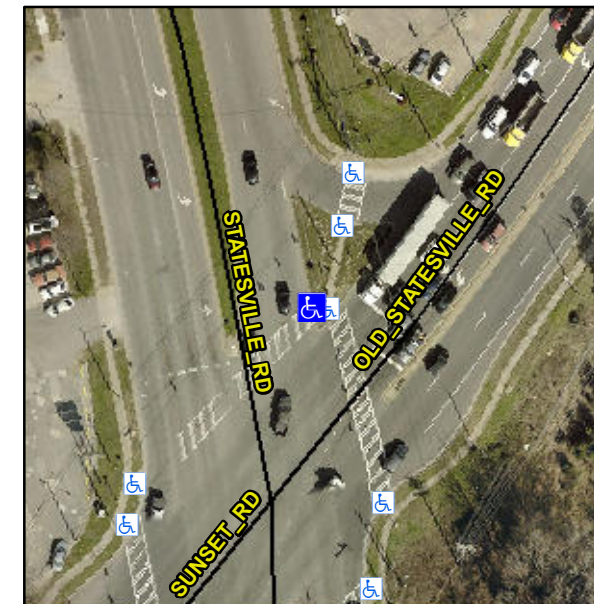

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.2, R302.7, R302.7.2

Total Cost: \$ 3400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	28.0	Yes	Ramp Slope (%)	5.7
Yes	Ramp Width (in)	50.0	Yes	Ramp XSlope (%)	0.9
N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	37.0	N/A	Flare Slope RT (%)	36.1
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
No	Landing Length (in)	37.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	63.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.9	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	0.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
N/A	Shared Landing?	Yes			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	1.7
No	Gutter Lip Ht (in)	0.3	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	126.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.7		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

