


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 29130	Main Street: APPLEDALE_DR	Cross Street: COVELO_CT	Location:	N
ADA ID: 60492311B9BB	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 27.5
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

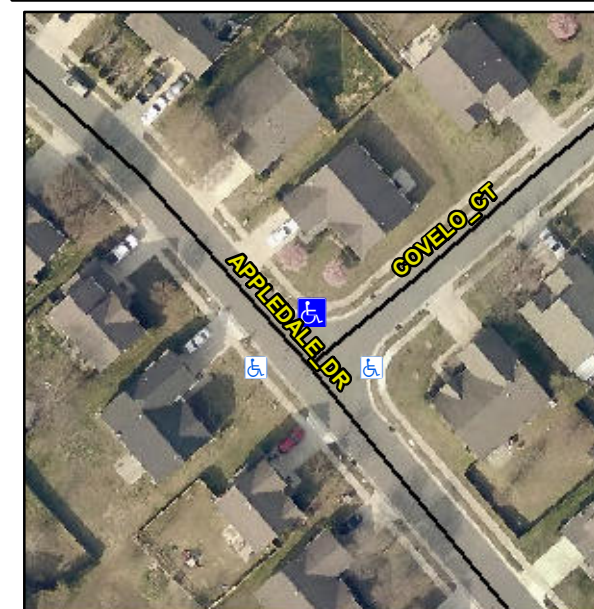

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R302.7.2**

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	97.5	Yes	Ramp Slope (%)	7.0
Yes	Ramp Width (in)	84.0	Yes	Ramp XSlope (%)	1.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	3.6	Yes	Flare Slope RT (%)	3.4
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	No	DWS Provided?	No
No	Landing Width (in)	N/A	N/A	DWS Contrast?	No
No	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.5
No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	2.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.1		X Walk 2 Slope (%)	1.6
	X Walk 1 X Slope (%)	3.1		X Walk 2 X Slope (%)	1.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.5	N/A	Clear Space?	Yes
	Road X Slope (%)	1.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

