


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 18026	Main Street: E_INDEPENDENCE_BV	Cross Street: WALLACE_LN	Location: SE
ADA ID: 6069B4F5D67F	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 13.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

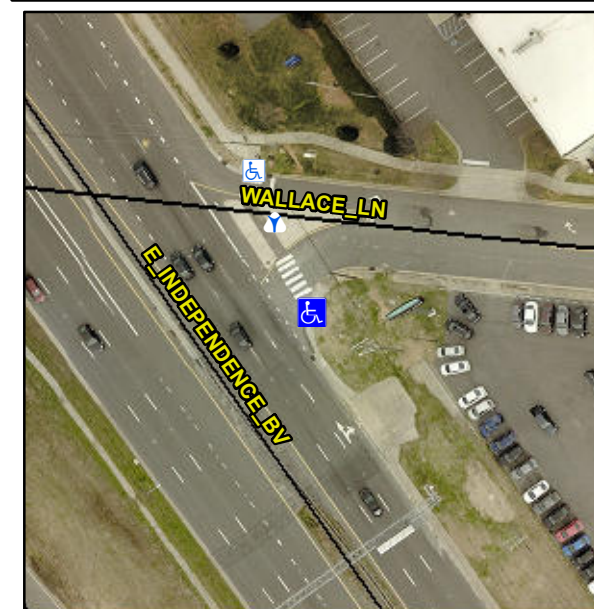

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

RT RP < 5%

PROW/ADA:

R304.3.2, R304.5.3

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	65.0	N/A	Ramp Length RT (in)	68.0
Yes	Ramp Width LT (in)	51.0	Yes	Ramp Width RT (in)	53.0
No	Ramp Slope LT (%)	8.7	Yes	Ramp Slope RT (%)	3.7
No	Ramp XSlope LT (%)	2.2	Yes	Ramp XSlope RT (%)	1.0
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	120.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.0		X Walk 2 Slope (%)	2.7
	X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	3.6
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.0	N/A	Clear Space?	N/A
	Road X Slope (%)	3.8	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	14.7

Street 1 Name WALLACE LN
 Stop Condition-Street 1 StopSign
 Street 2 Name E INDEPENDENCE BV
 Stop Condition-Street 2 None

