

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: NORTHLAKE CENTRE PY	Cross Street: N/A	Location: NW
ADA ID: 60C064FA1FC4	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

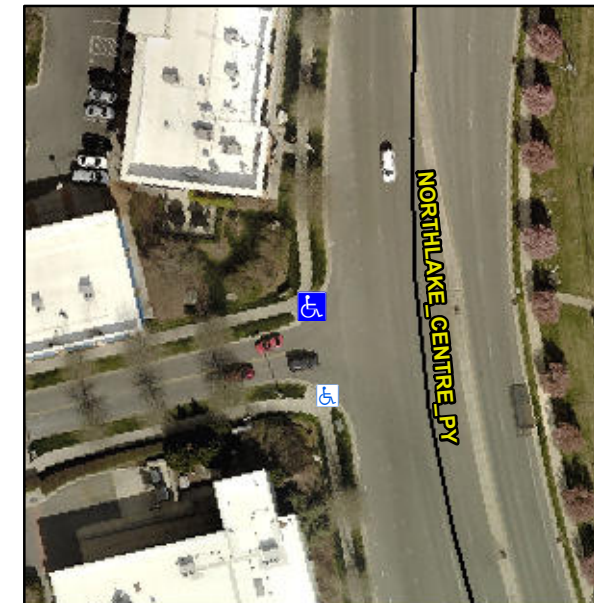

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.2

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	53.0	Yes	Ramp Slope (%)	6.6
Yes	Ramp Width (in)	50.0	Yes	Ramp XSlope (%)	0.9
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	5.3	N/A	Flare Slope RT (%)	5.0
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	70.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	38.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.9
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To E
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.7		X Walk 2 Slope (%)	3.2
	X Walk 1 X Slope (%)	2.1		X Walk 2 X Slope (%)	4.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.8	N/A	Clear Space?	Yes
	Road X Slope (%)	1.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3200.00

Street 1 Name ENTRANCE
 Stop Condition-Street 2 StopSign
 Street 2 Name NORTHLAKE CENTRE PY
 Stop Condition-Street 1 None

